


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

| | | | |
|------------------------|----------------------------|-----------------------------------|------------------------|
| Intersection ID: 49251 | Main Street: RIDGE_PATH_LN | Cross Street: PROSPERITY_RIDGE_RD | Location: W |
| ADA ID: 715AB0D8550D | Ramp Type: Perp | Initial Pass/Fail: Pass | Overall Compliance: No |
| | | Severity Score: 2.75 | |

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

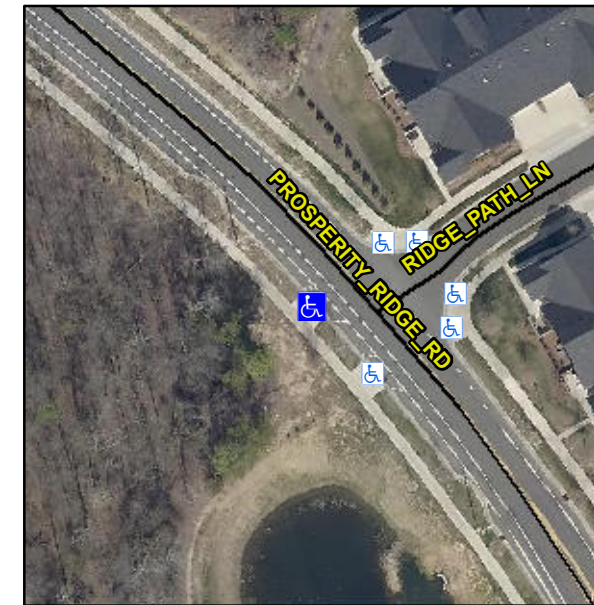

Possible Solutions:

Remove & Replace Flare.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.3

Total Cost:

\$ 300.00

| Compliance | Description | Data | Compliance | Description | Data |
|------------|-----------------------|--------|------------|-----------------------------|------|
| N/A | Ramp Length (in) | 95.0 | Yes | Ramp Slope (%) | 7.6 |
| Yes | Ramp Width (in) | 48.0 | Yes | Ramp XSlope (%) | 2.1 |
| N/A | Flare Type LT | Sloped | N/A | Flare Type RT | N/A |
| N/A | Flare Slope LT (%) | 2.6 | No | Flare Slope RT (%) | 11.2 |
| N/A | Flare Traversable LT? | Yes | N/A | Flare Traversable RT? | Yes |
| Yes | Landing Length (in) | 70.0 | Yes | DWS Provided? | Yes |
| Yes | Landing Width (in) | 48.0 | Yes | DWS Contrast? | Yes |
| Yes | Landing Slope (%) | 1.4 | Yes | DWS Length (in) | 24.0 |
| Yes | Landing X Slope (%) | 3.7 | Yes | DWS Full Width? | Yes |
| N/A | Landing Curb? (Y/N) | No | Yes | DWS Offset (in) | 0.0 |
| N/A | Shared Landing? | No | | | |
| Yes | Gutter Ponding? | No | Yes | Gutter Slope (%) | 2.2 |
| Yes | Gutter Lip Ht (in) | 0.0 | Yes | Gutter X Slope (%) | 2.4 |
| N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | N/A |
| | X Walk 1 Direction | To NE | | X Walk 2 Direction | N/A |
| N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 4.2 | | X Walk 2 Slope (%) | N/A |
| | X Walk 1 X Slope (%) | 3.9 | | X Walk 2 X Slope (%) | N/A |
| N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | N/A | N/A | Clear Space? | Yes |
| | Road X Slope (%) | N/A | N/A | Clear Space to XWalk (in) | N/A |
| Yes | Any Obstructions? | No | Yes | Storm Grate/Utility Hazard? | No |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |

| | |
|-------------------------|---------------------|
| Street 1 Name | PROSPERITY RIDGE RD |
| Stop Condition-Street 2 | None |
| Street 2 Name | N/A |
| Stop Condition-Street 1 | N/A |

