

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11157	Main Street: N_IRWIN_AV	Cross Street: W_6TH_ST	Location: W
ADA ID: 71C89F10C8AF	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

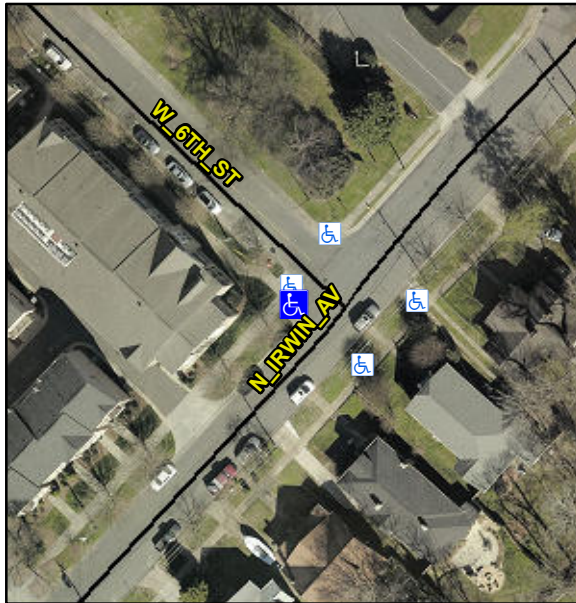

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3

Street 1 Name	N IRWIN AV
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	62.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	72.0	Yes	Grade Break Slope (%)	3.2
Yes	Ramp Slope (%)	1.2	No	Grade Break XSlope (%)	3.4
No	Ramp XSlope (%)	2.5			
N/A	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	6.6	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	71.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	71.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.9	Yes	DWS Length (in)	24.5
No	Landing X Slope (%)	2.3	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	47.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	1.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.5
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.1
N/A	Painted X Walk1?	No		Road Slope (%)	3.1
	X Walk 1 Direction	To SE		Road X Slope (%)	1.4
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	3.1	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.4	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	19.2

