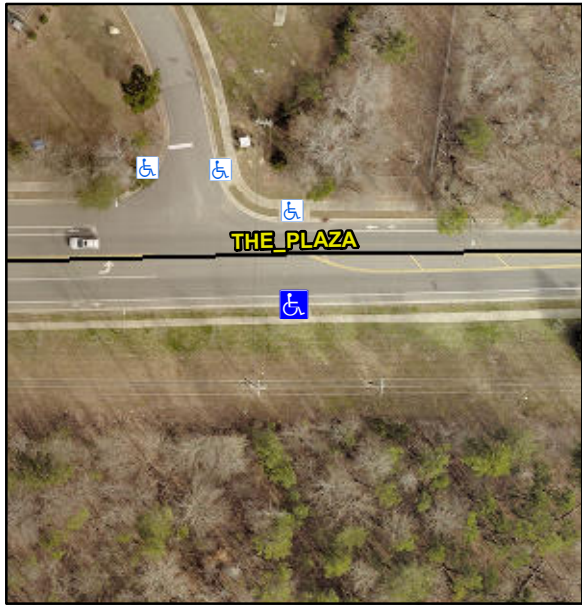
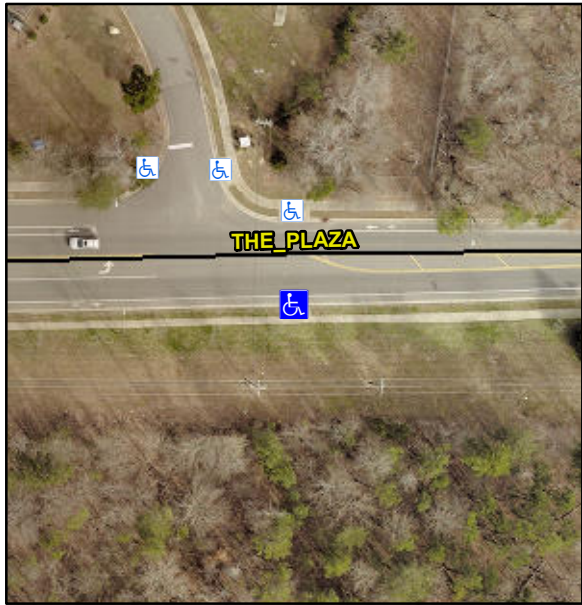


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10014838		Main Street: THE_PLAZA		Cross Street: N/A		Location:		SE	
ADA ID: 71F8C68F8A48		Ramp Type: Combination2		Initial Pass/Fail: Pass		Overall Compliance: No		Severity Score: 0.25	
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
		Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
		Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	72.0	N/A	Ramp Length RT (in)	N/A
		Remove & Replace Gutter.		Yes	Ramp Width LT (in)	60.0	N/A	Ramp Width RT (in)	N/A
				Yes	Ramp Slope LT (%)	6.6	N/A	Ramp Slope RT (%)	N/A
				No	Ramp XSlope LT (%)	2.2	N/A	Ramp XSlope RT (%)	N/A
				N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	5.9
				Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.6
		Surveyor Notes:		N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
		N/A		N/A	Flare Slope LT (%)	9.6	N/A	Flare Slope RT (%)	4.6
				N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
		PROW/ADA:		Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
				Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
		Not Found, R304.5.3, R304.2.2-Perp, R304.3.2-Para		No	Landing Slope (%)	6.4	Yes	DWS Length (in)	24.0
				No	Landing X Slope (%)	2.7	Yes	DWS Full Width?	Yes
				N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
				N/A	Shared Landing?	No			
				Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.9
				Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.6
				N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
					X Walk 1 Direction	To N		X Walk 2 Direction	N/A
Street 1 Name		None			X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
Stop Condition-Street 1		THE PLAZA			X Walk 1 Slope (%)	3.5		X Walk 2 Slope (%)	N/A
Street 2 Name		N/A			X Walk 1 X Slope (%)	1.4		X Walk 2 X Slope (%)	N/A
Stop Condition-Street 2		N/A			Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
					Road Slope (%)	N/A		Clear Space?	Yes
					Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
							Yes	Any Obstruction?	No
								Obstruction Type	N/A
							Yes	Storm Grate/Utility Hazard?	No
								Storm Grate/Utility Type	N/A
							Yes	Surface Condition? (G/P)	Good
								Curb Slope (%)	11.5
		Total Cost:		\$	2350.00				
