


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 52688	Main Street: CITY_PARK_DR	Cross Street: ARBOR_LOOP_DR	Location: SW
ADA ID: 7291B4A3B6ED	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 1.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		Yes	Ramp Length (in)	72.0
			N/A	Ramp Width (in)	70.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
<p>Surveyor Notes:</p> <p>N/A</p>			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	Yes
			N/A	X Walk 1 Direction	To SE
			N/A	X Walk 1 Width (in)	112.0
			N/A	X Walk 1 Slope (%)	2.8
<p>PROW/ADA:</p> <p>R304.5.3</p>			N/A	X Walk 1 X Slope (%)	4.5
			N/A	Ramp inside XWalk1?	Yes
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
			N/A	Obstruction Type	
			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
			N/A	Storm Grate/Utility Type	
<p>Total Cost:</p> <p>\$ 1850.00</p>			N/A	Surface Condition? (G/P)	Good

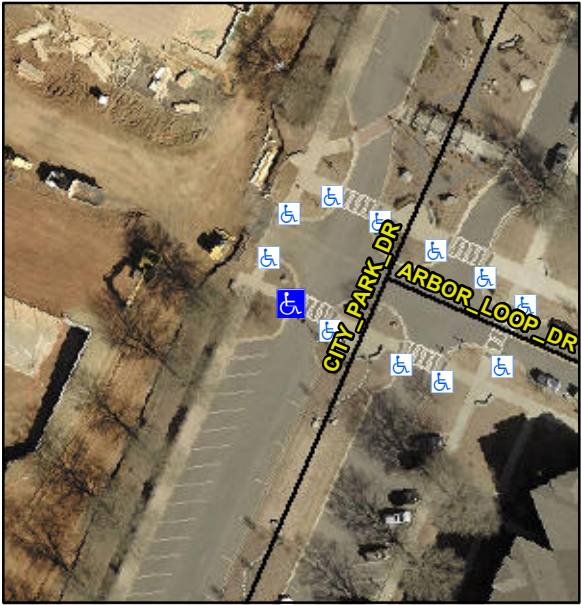