


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                                         |                          |                                         |                        |
|-----------------------------------------|--------------------------|-----------------------------------------|------------------------|
| Intersection ID: 16683                  | Main Street: RENSFORD_AV | Cross Street: SHARON_RD                 | Location: NE           |
| ADA ID: 72D5DD6ECAA1                    | Ramp Type: PerpDiag      | Initial Pass/Fail: Fail                 | Overall Compliance: No |
| Severity Score: 21.25                   |                          |                                         |                        |
| Codes/Mitigation Info/Possible Solution |                          | Field Measurements/Component Compliance |                        |

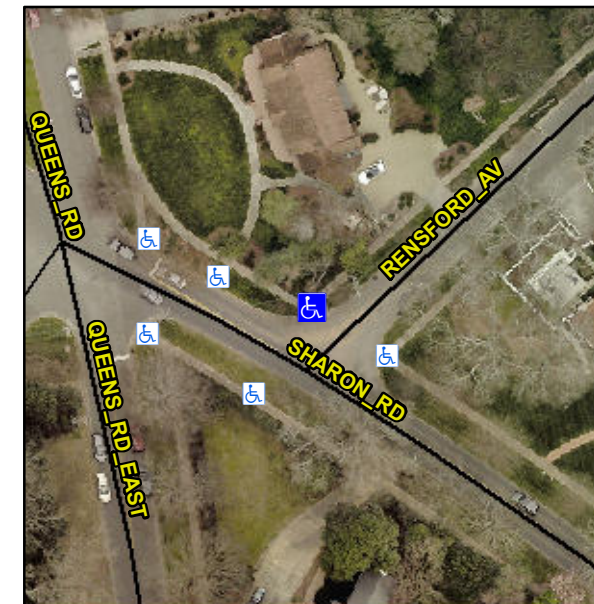

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.1, R304.2.2**

Total Cost: \$ 3200.00

| Compliance | Description           | Data  | Compliance | Description                 | Data  |
|------------|-----------------------|-------|------------|-----------------------------|-------|
| N/A        | Ramp Length (in)      | 64.0  | No         | Ramp Slope (%)              | 9.1   |
| No         | Ramp Width (in)       | 41.0  | Yes        | Ramp XSlope (%)             | 0.3   |
| N/A        | Flare Type LT         | N/A   | N/A        | Flare Type RT               | N/A   |
| N/A        | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | N/A   |
| N/A        | Flare Traversable LT? | N/A   | N/A        | Flare Traversable RT?       | N/A   |
| N/A        | Landing Length (in)   | N/A   | N/A        | DWS Provided?               | N/A   |
| N/A        | Landing Width (in)    | N/A   | N/A        | DWS Contrast?               | N/A   |
| N/A        | Landing Slope (%)     | N/A   | N/A        | DWS Length (in)             | N/A   |
| N/A        | Landing X Slope (%)   | N/A   | N/A        | DWS Full Width?             | N/A   |
| N/A        | Landing Curb? (Y/N)   | N/A   | N/A        | DWS Offset (in)             | N/A   |
| N/A        | Shared Landing?       | N/A   |            |                             |       |
| N/A        | Gutter Ponding?       | N/A   | N/A        | Gutter Slope (%)            | N/A   |
| N/A        | Gutter Lip Ht (in)    | N/A   | N/A        | Gutter X Slope (%)          | N/A   |
| N/A        | Painted X Walk1?      | No    | N/A        | Painted X Walk2?            | No    |
|            | X Walk 1 Direction    | To SW |            | X Walk 2 Direction          | To SE |
| N/A        | X Walk 1 Width (in)   | N/A   | N/A        | X Walk 2 Width (in)         | N/A   |
|            | X Walk 1 Slope (%)    | 0.6   |            | X Walk 2 Slope (%)          | 2.8   |
|            | X Walk 1 X Slope (%)  | 2.1   |            | X Walk 2 X Slope (%)        | 2.3   |
| N/A        | Ramp inside XWalk1?   | N/A   | N/A        | Ramp inside XWalk2?         | N/A   |
|            | Road Slope (%)        | 2.1   | N/A        | Clear Space?                | N/A   |
|            | Road X Slope (%)      | 0.0   | N/A        | Clear Space to XWalk (in)   | N/A   |
| N/A        | Any Obstructions?     | N/A   | N/A        | Storm Grate/Utility Hazard? | N/A   |
|            | Obstruction Type      |       |            | Storm Grate/Utility Type    |       |
|            |                       | N/A   |            |                             | N/A   |
|            |                       | Yes   |            | Surface Condition? (G/P)    | Good  |

