

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: OLD_CONCORD_RD	Cross Street: W_T_HARRIS_BV	Location: NW
ADA ID: 73A763F58D5C	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 10	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

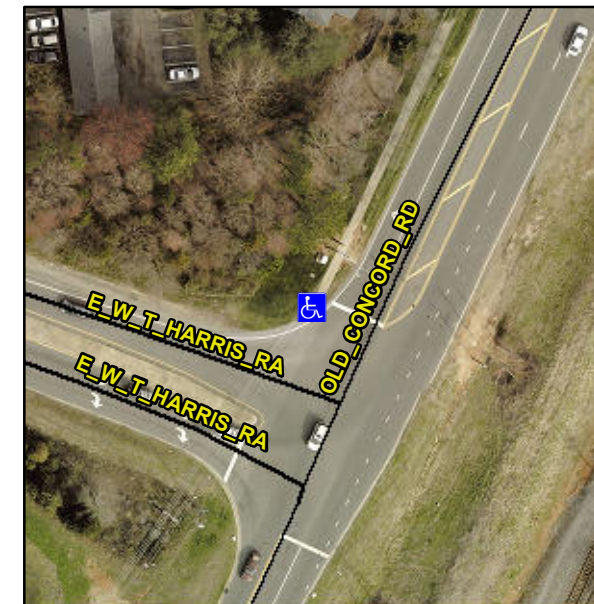

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2-Perp, R304.3.2-Para, R305

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	101.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	57.5	Yes	Grade Break Slope (%)	0.0
Yes	Ramp Slope (%)	3.0	Yes	Grade Break XSlope (%)	1.2
Yes	Ramp XSlope (%)	0.7			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	57.5	No	DWS Provided?	No
Yes	Landing Width (in)	58.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	3.3	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	1.3	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
N/A	Shared Landing?	No	N/A	DWS Offset RT (in)	N/A
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.0
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.6
N/A	Painted X Walk1?	No		Road Slope (%)	2.0
	X Walk 1 Direction	To S		Road X Slope (%)	3.2
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	2.0	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	3.2	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	1.3

