


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 5833	Main Street: GUM_BRANCH_RD	Cross Street: KENTBERRY_DR	Location: W
ADA ID: 7447D6AFBE8D	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 2.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

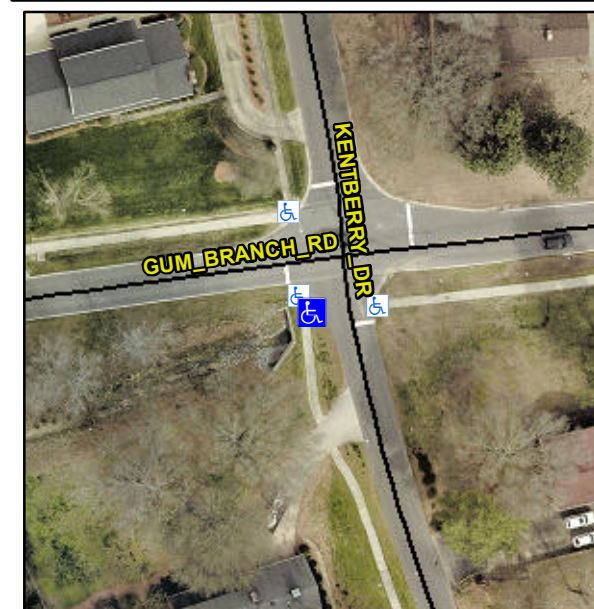

Possible Solutions:

**Remove & Replace Detectable Warning System.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R305.1.4, R305.2**

Total Cost:

\$ 800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	49.5	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	60.0	Yes	Grade Break Slope (%)	2.2
Yes	Ramp Slope (%)	1.5	Yes	Grade Break XSlope (%)	0.2
Yes	Ramp XSlope (%)	1.3			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	58.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	58.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.9	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	0.4	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	24.5
N/A	Shared Landing?	Yes	No	DWS Offset RT (in)	4.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.6
N/A	Painted X Walk1?	No		Road Slope (%)	4.5
	X Walk 1 Direction	To E		Road X Slope (%)	0.4
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	4.5	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.4	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	0.1

