


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 53405	Main Street: LUTHER_ST	Cross Street: MORGAN_PARK_DR	Location: W
ADA ID: 74CC1EEBF968	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

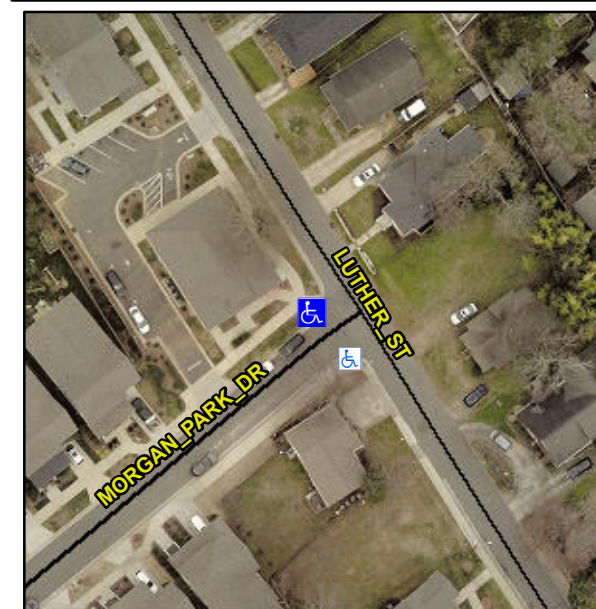

Possible Solutions:

Remove & Replace Detectable Warning System.

Surveyor Notes:

N/A

PROW/ADA:

R305.2

Total Cost:

\$ 800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	29.0	Yes	BlendTrans Slope (%)	2.5
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	0.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	0.0	N/A	Flare Slope RT (%)	5.3
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	74.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.2	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.5	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	5.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.0		X Walk 2 Slope (%)	3.8
	X Walk 1 X Slope (%)	3.0		X Walk 2 X Slope (%)	1.7
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.4		Clear Space?	Yes
	Road X Slope (%)	5.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	3.0

Street 1 Name **MORGAN PARK DR**
 Stop Condition-Street 1 **StopSign**
 Street 2 Name **LUTHER ST**
 Stop Condition-Street 2 **None**

