


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

| | | | |
|---|-------------------------------------|---|------------------------|
| Intersection ID: 49102 | Main Street: PROSPERITY_CROSSING_DR | Cross Street: BENFIELD_RD | Location: E |
| ADA ID: 7575CDCC0032 | Ramp Type: Directional1 | Initial Pass/Fail: Pass | Overall Compliance: No |
| Severity Score: 5 | | | |
| Codes/Mitigation Info/Possible Solution | | Field Measurements/Component Compliance | |

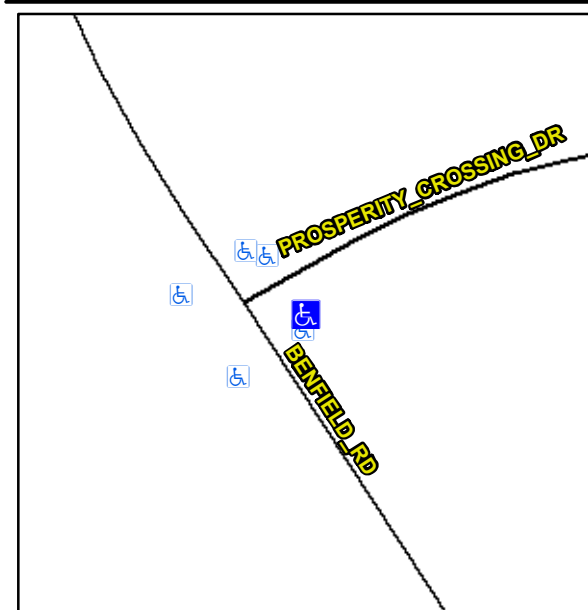

Possible Solutions:

Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.4

| | |
|-------------------------|-------------------------------|
| Street 1 Name | PROSPERITY CROSSING DR |
| Stop Condition-Street 1 | StopSign |
| Street 2 Name | N/A |
| Stop Condition-Street 2 | N/A |

Total Cost: \$ **750.00**

| Compliance | Description | Data | Compliance | Description | Data |
|------------|-----------------------|-------|------------|-----------------------------|------|
| N/A | Ramp Length (in) | 44.0 | Yes | Grade Break? | Yes |
| Yes | Ramp Width (in) | 71.0 | Yes | Grade Break Slope (%) | 0.2 |
| Yes | Ramp Slope (%) | 1.4 | Yes | Grade Break XSlope (%) | 0.3 |
| Yes | Ramp XSlope (%) | 0.9 | | | |
| N/A | Flare Type LT | N/A | N/A | Flare Type RT | N/A |
| N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| N/A | Flare Traversable LT? | N/A | N/A | Flare Traversable RT? | N/A |
| Yes | Landing Length (in) | 72.0 | Yes | DWS Provided? | Yes |
| Yes | Landing Width (in) | 72.0 | Yes | DWS Contrast? | Yes |
| Yes | Landing Slope (%) | 0.8 | Yes | DWS Length (in) | 24.0 |
| Yes | Landing X Slope (%) | 0.8 | Yes | DWS Full Width? | Yes |
| N/A | Landing Curb? (Y/N) | No | Yes | DWS Offset LT (in) | 33.0 |
| N/A | Shared Landing? | Yes | Yes | DWS Offset RT (in) | 1.0 |
| Yes | Gutter Ponding? | No | No | Gutter Slope (%) | 6.2 |
| Yes | Gutter Lip Ht (in) | 0.0 | Yes | Gutter X Slope (%) | 0.9 |
| N/A | Painted X Walk1? | No | | Road Slope (%) | 4.2 |
| | X Walk 1 Direction | To NW | | Road X Slope (%) | 0.8 |
| | X Walk 1 Width (in) | N/A | | Clear Space? | Yes |
| | X Walk 1 Slope (%) | 4.2 | N/A | Clear Space to XWalk (in) | N/A |
| | X Walk 1 X Slope (%) | 0.8 | Yes | Storm Grate/Utility Hazard? | No |
| N/A | Ramp inside XWalk1? | N/A | | Storm Grate/Utility Type | |
| Yes | Any Obstructions? | No | | | N/A |
| | Obstruction Type | | Yes | Surface Condition? (G/P) | Good |
| | | | N/A | Curb Slope (%) | 6.7 |

