


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 3953		Main Street: BENTHAVEN_LN		Cross Street: COLESHIRE_CT		Location:		SW									
ADA ID: 75A672203F22		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 22.5									
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance													
				Possible Solutions:		Compliance		Description		Data		Compliance		Description		Data	
				Remove & Replace Entire Ramp.		N/A		Ramp Length (in)		62.0		N/A		Grade Break?		N/A	
				Surveyor Notes:		No		Ramp Width (in)		47.0		N/A		Grade Break Slope (%)		0.0	
				N/A		No		Ramp Slope (%)		9.8		N/A		Grade Break XSlope (%)		0.0	
				PROW/ADA:		No		Ramp XSlope (%)		3.5		N/A		Flare Type LT		N/A	
				R304.5.1, R304.2.2, R304.5.3		N/A		Flare Slope LT (%)		N/A		N/A		Flare Slope RT (%)		0.0	
						N/A		Flare Traversable LT?		N/A		N/A		Flare Traversable RT?		N/A	
						N/A		Landing Length (in)		0.0		N/A		DWS Provided?		N/A	
						N/A		Landing Width (in)		0.0		N/A		DWS Contrast?		N/A	
						N/A		Landing Slope (%)		0.0		N/A		DWS Length (in)		N/A	
						N/A		Landing X Slope (%)		0.0		N/A		DWS Full Width?		N/A	
						N/A		Landing Curb? (Y/N)		N/A		N/A		DWS Offset LT (in)		N/A	
						N/A		Shared Landing?		N/A		N/A		DWS Offset RT (in)		N/A	
						N/A		Gutter Ponding?		0.0		N/A		Gutter Slope (%)		N/A	
						N/A		Gutter Lip Ht (in)		0.0		N/A		Gutter X Slope (%)		N/A	
						N/A		Painted X Walk1?		No				Road Slope (%)		3.5	
								X Walk 1 Direction		To N				Road X Slope (%)		0.2	
								X Walk 1 Width (in)		N/A				Clear Space?		N/A	
								X Walk 1 Slope (%)		3.5		N/A		Clear Space to XWalk (in)		N/A	
								X Walk 1 X Slope (%)		0.2		N/A		Storm Grate/Utility Hazard?		N/A	
						N/A		Ramp inside XWalk1?		N/A				Storm Grate/Utility Type			
						N/A		Any Obstructions?		N/A							
								Obstruction Type				Yes		Surface Condition? (G/P)		Good	
												N/A		N/A		Curb Slope (%)	
				Total Cost:		\$		1600.00									

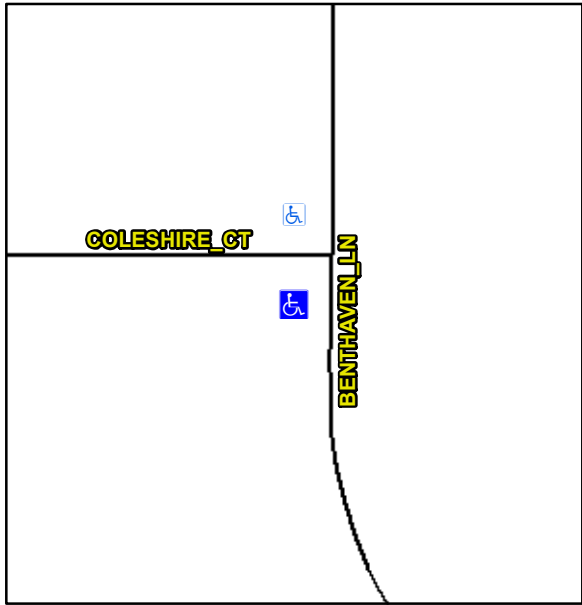