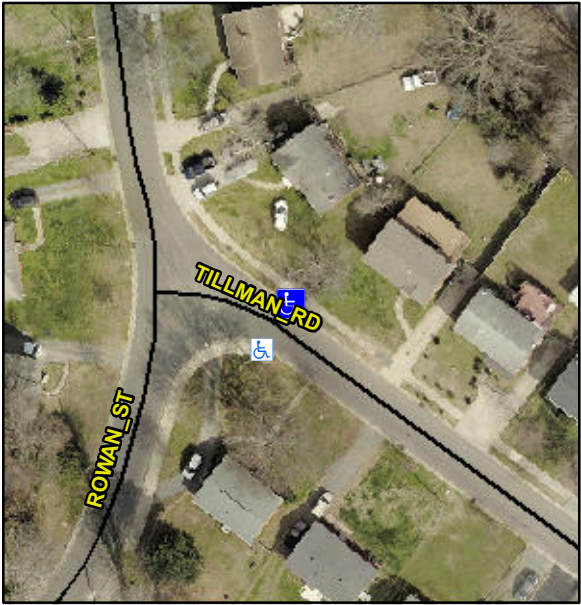


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 8673	Main Street: ROWAN_ST	Cross Street: TILLMAN_RD	Location: NE
ADA ID: 75E2459A3D0D	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 1.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		Yes	Ramp Length (in)	47.5
			N/A	Ramp Width (in)	48.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
Surveyor Notes: N/A PROW/ADA: Not Found, R304.5.3			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
			N/A	X Walk 1 Direction	To SW
			N/A	X Walk 1 Width (in)	N/A
			N/A	X Walk 1 Slope (%)	2.9
			N/A	X Walk 1 X Slope (%)	3.2
Total Cost: \$ 1850.00			N/A	Ramp inside XWalk1?	N/A
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
			N/A	Obstruction Type	
			N/A		
			N/A		
			N/A		
			N/A		
			N/A		
Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1	TILLMAN RD		N/A	Storm Grate/Utility Hazard?	N/A
	StopSign		N/A	Storm Grate/Utility Type	
	N/A		N/A		
	N/A		N/A		
			N/A		
			N/A		
			N/A		
			N/A		
			N/A		
			N/A		
Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1	TILLMAN RD		Yes	Surface Condition? (G/P)	Good
	StopSign				
	N/A				
	N/A				

