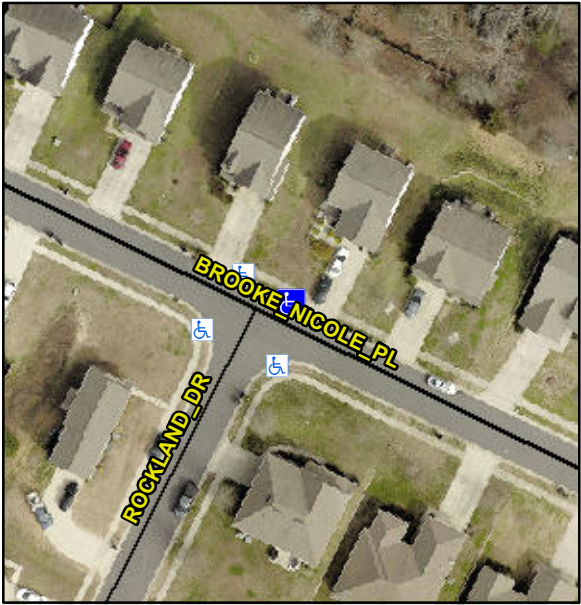


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 49252	Main Street: ROCKLAND_DR	Cross Street: BROOKE_NICOLE_PL	Location:	E
ADA ID: 75F7AAA0ADA2	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	48.0	Yes
			Yes	Ramp Width (in)	48.0	No
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Landing Length (in)	N/A	N/A
			N/A	Landing Width (in)	N/A	N/A
			N/A	Landing Slope (%)	N/A	N/A
			N/A	Landing X Slope (%)	N/A	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.3</p>			N/A	Flare Type RT	N/A	N/A
			N/A	Flare Slope RT (%)	N/A	N/A
			N/A	Flare Traversable RT?	N/A	N/A
			N/A	DWS Provided?	N/A	N/A
			N/A	DWS Contrast?	N/A	N/A
			N/A	DWS Length (in)	N/A	N/A
			N/A	DWS Full Width?	N/A	N/A
			N/A	DWS Offset (in)	N/A	N/A
			N/A	Gutter Ponding?	N/A	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A
			N/A	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To S	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	3.8	N/A
				X Walk 1 X Slope (%)	8.7	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A
				Road Slope (%)	N/A	N/A
				Road X Slope (%)	N/A	N/A
			N/A	Any Obstructions?	N/A	N/A
				Obstruction Type		N/A
Total Cost:		\$ 1850.00				N/A
						Yes
						Good

Street 1 Name	BROOKE NICOLE PL
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

