

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

71.0

42.0

12.0

1.2

3.9

Good

0.5

Intersection ID: 11644 Main Street: HILLIARD DR **Cross Street: PALM AV** Location: SE Ramp Type: Combination1 Initial Pass/Fail: Fail **Overall Compliance: No** ADA ID: 76451AA8CB68 Severity Score: 46.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

N/A

No

Yes

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp XSlope RT (%)

Ramp Slope (%)

Data

67.0

41.0

1.4 No

1.5

66.0 Yes

Ramp Length LT (in)

Ramp Width LT (in)

Ramp Slope LT (%)


Ramp Length (in)

Ramp XSlope LT (%)



Street 1 Name None Stop Condition-Street 1 **HILLIARD DR** Street 2 Name N/A Stop Condition-Street 2 N/A

Possible Solutions: Compliance Description Remove & Replace Entire Ramp. N/A No Yes Yes N/A Yes Surveyor Notes: N/A N/A LT RP < 5% N/A N/A N/A PROW/ADA: N/A R304.5.1, R304.5.3, R304.3.2 N/A N/A N/A N/A N/A N/A

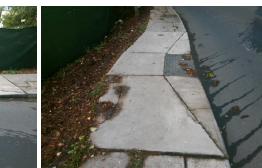

Total Cost:



1800.00

	,				
Yes	Ramp Width (in)	50.0	No	Ramp XSlope (%)	5.8
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	7.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	7.2		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
4			N/A	Any Obstruction?	N/A
				Obstruction Type	
					N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	
					N/A

Yes

Surface Condition? (G/P)

Curb Slope (%)