

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

| | | | |
|----------------------|------------------------------|-------------------------|------------------------|
| Intersection ID: N/A | Main Street: INDEPENDENCE_RD | Cross Street: N/A | Location: N |
| ADA ID: 7683625896AF | Ramp Type: Directional1 | Initial Pass/Fail: Pass | Overall Compliance: No |
| | | Severity Score: 10 | |

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

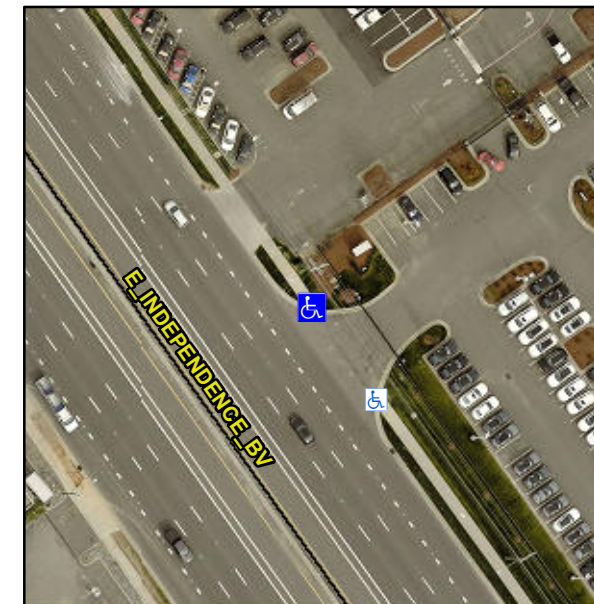

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,
R304.5.2, R305, R304.5.3**

| Compliance | Description | Data | Compliance | Description | Data |
|------------|-----------------------|-------|------------|-----------------------------|------|
| N/A | Ramp Length (in) | 67.0 | No | Grade Break? | No |
| Yes | Ramp Width (in) | 72.0 | N/A | Grade Break Slope (%) | 4.8 |
| Yes | Ramp Slope (%) | 3.7 | N/A | Grade Break XSlope (%) | 1.2 |
| Yes | Ramp XSlope (%) | 0.4 | | | |
| N/A | Flare Type LT | N/A | N/A | Flare Type RT | N/A |
| N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| N/A | Flare Traversable LT? | N/A | N/A | Flare Traversable RT? | N/A |
| Yes | Landing Length (in) | 68.0 | No | DWS Provided? | No |
| Yes | Landing Width (in) | 72.0 | N/A | DWS Contrast? | No |
| No | Landing Slope (%) | 3.9 | N/A | DWS Length (in) | N/A |
| Yes | Landing X Slope (%) | 0.9 | N/A | DWS Full Width? | No |
| N/A | Landing Curb? (Y/N) | N/A | N/A | DWS Offset LT (in) | N/A |
| N/A | Shared Landing? | No | N/A | DWS Offset RT (in) | N/A |
| Yes | Gutter Ponding? | No | Yes | Gutter Slope (%) | 1.9 |
| Yes | Gutter Lip Ht (in) | 0.0 | No | Gutter X Slope (%) | 4.3 |
| N/A | Painted X Walk1? | No | | Road Slope (%) | 1.8 |
| | X Walk 1 Direction | To SE | | Road X Slope (%) | 4.1 |
| | X Walk 1 Width (in) | N/A | | Clear Space? | Yes |
| | X Walk 1 Slope (%) | 1.8 | N/A | Clear Space to XWalk (in) | N/A |
| | X Walk 1 X Slope (%) | 4.1 | Yes | Storm Grate/Utility Hazard? | No |
| N/A | Ramp inside XWalk1? | N/A | | Storm Grate/Utility Type | |
| Yes | Any Obstructions? | No | | | N/A |
| | Obstruction Type | | Yes | Surface Condition? (G/P) | Good |
| | | | N/A | Curb Slope (%) | 8.0 |

Total Cost: \$ 2350.00

| | |
|-------------------------|----------|
| Street 1 Name | ENTRANCE |
| Stop Condition-Street 1 | None |
| Street 2 Name | N/A |
| Stop Condition-Street 2 | N/A |

