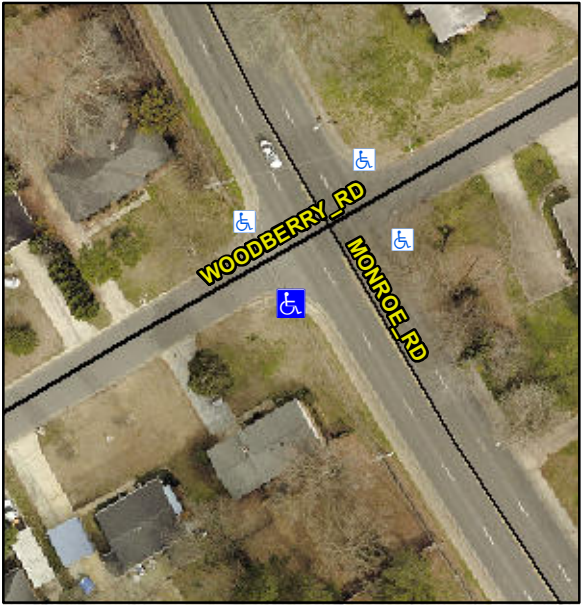


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 18787	Main Street: MONROE_RD	Cross Street: WOODBERRY_RD	Location: SW
ADA ID: 76E84C7F2BCD	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		No	Ramp Length (in)	60.0	Ramp Slope (%)
			Yes	Ramp Width (in)	48.0	Ramp XSlope (%)
			N/A	Flare Type LT	N/A	Flare Type RT
			N/A	Flare Slope LT (%)	N/A	Flare Slope RT (%)
			N/A	Flare Traversable LT?	N/A	Flare Traversable RT?
			N/A	Landing Length (in)	N/A	DWS Provided?
			N/A	Landing Width (in)	N/A	DWS Contrast?
			N/A	Landing Slope (%)	N/A	DWS Length (in)
			N/A	Landing X Slope (%)	N/A	DWS Full Width?
			N/A	Landing Curb? (Y/N)	N/A	DWS Offset (in)
			N/A	Shared Landing?	N/A	
			N/A	Gutter Ponding?	N/A	Gutter Slope (%)
			N/A	Gutter Lip Ht (in)	N/A	Gutter X Slope (%)
			N/A	Painted X Walk1?	No	Painted X Walk2?
				X Walk 1 Direction	To E	X Walk 2 Direction
			N/A	X Walk 1 Width (in)	N/A	X Walk 2 Width (in)
				X Walk 1 Slope (%)	3.3	X Walk 2 Slope (%)
				X Walk 1 X Slope (%)	2.7	X Walk 2 X Slope (%)
			N/A	Ramp inside XWalk1?	N/A	Ramp inside XWalk2?
				Road Slope (%)	1.5	Clear Space?
				Road X Slope (%)	4.3	Clear Space to XWalk (in)
			N/A	Any Obstructions?	N/A	Storm Grate/Utility Hazard?
				Obstruction Type		Storm Grate/Utility Type
			N/A			N/A
			Yes	Surface Condition? (G/P)		Good

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2

Total Cost: \$ 3200.00

Street 1 Name **MONROE RD**
 Stop Condition-Street 2 **StopSign**
 Street 2 Name **WOODBERRY RD**
 Stop Condition-Street 1 **None**

