

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 29320	Main Street: N_TRYON_ST	Cross Street: UNIVERSITY_EXECUTIVE_PARK_DR	Location: SW
ADA ID: 77184DFC0FC4	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

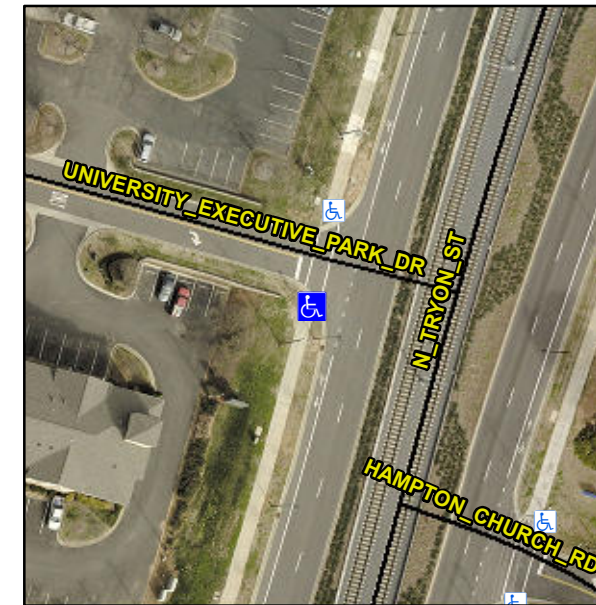

Possible Solutions:

Remove & Replace Landing.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2-Perp, R304.3.2-Para

Total Cost: \$ 500.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	94.0	N/A	Grade Break?	N/A
Yes	Ramp Width (in)	91.0	N/A	Grade Break Slope (%)	0.0
Yes	Ramp Slope (%)	2.7	N/A	Grade Break XSlope (%)	0.0
Yes	Ramp XSlope (%)	0.9			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	91.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	4.8	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	0.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	0.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	Yes		Road Slope (%)	0.1
	X Walk 1 Direction	To N		Road X Slope (%)	2.0
	X Walk 1 Width (in)	100.0		Clear Space?	Yes
	X Walk 1 Slope (%)	0.1	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.0	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	3.6

