

## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)




Intersection ID: 10025367 Main Street: E\_8TH\_ST **Cross Street: N/A** Location: Ε

ADA ID: 77779A9022CF Ramp Type: Perp Initial Pass/Fail: Fail **Overall Compliance: No Severity Score:** 12.5

## **Codes/Mitigation Info/Possible Solution**

## Field Measurements/Component Compliance

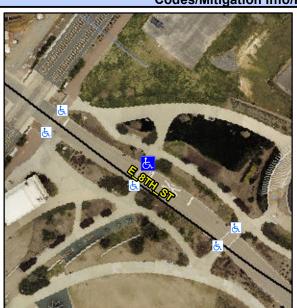

E8THST Street 1 Name YieldSign Stop Condition-Street 2 Street 2 Name N/A Stop Condition-Street 1 N/A

Possible Solutions: Remove & Replace Entire Ramp. Surveyor Notes: N/A PROW/ADA: R304.2.2

Total Cost: 1850.00

Comp	liance Description	Data	Comp	liance	Description	Data
N/A	Ramp Length (in)	112.0	No	Ramp	Slope (%)	9.3
Yes	Ramp Width (in)	64.0	Yes	Ramp	XSlope (%)	1.4
N/A	Flare Type LT	N/A	N/A	Flare	Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutte	r Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	r X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Paint	ed X Walk2?	N/A
	X Walk 1 Direction	To SW		X Wa	lk 2 Direction	N/A
N/A	X Walk 1 Width (in)	120.0	N/A	X Wa	lk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.3		X Wa	lk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.9		X Wa	lk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp	inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear	Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear	Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm	n Grate/Utility Hazard?	N/A
	Obstruction Type			Storm	n Grate/Utility Type	
		N/A				N/A
			Yes	Surfa	ce Condition? (G/P)	Good





