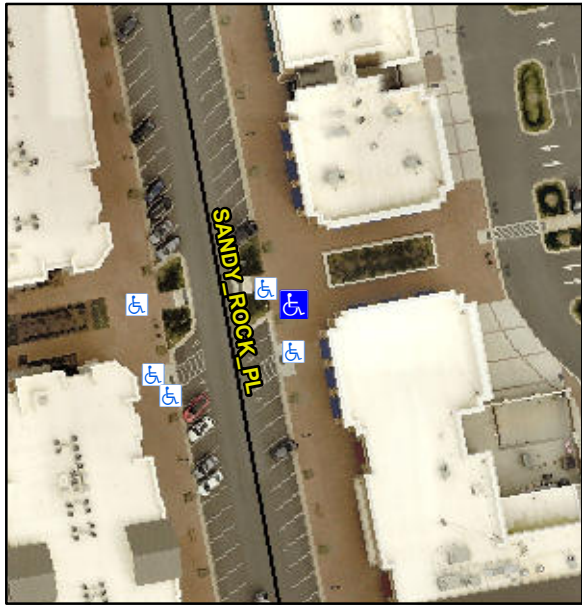


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10037212	Main Street: SANDY_ROCK_PL	Cross Street: N/A	Location:	E
ADA ID: 77E1B8F6C682	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		Compliance			Description			Data	
	Remove & Replace Gutter.		N/A	Ramp Length (in)	84.5	Yes	Ramp Slope (%)	6.7		
			Yes	Ramp Width (in)	59.5	Yes	Ramp XSlope (%)	0.8		
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	7.7	Yes	Flare Slope RT (%)	5.5		
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes		
			Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes		
			Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes		
			Yes	Landing Slope (%)	0.5	Yes	DWS Length (in)	24.0		
			Yes	Landing X Slope (%)	1.8	Yes	DWS Full Width?	Yes		
Surveyor Notes:		N/A			N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
PROW/ADA:		R304.5.3			N/A	Shared Landing?	No			
		Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.1			
		Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.9			
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A			
			X Walk 1 Direction	To W		X Walk 2 Direction	N/A			
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A			
			X Walk 1 Slope (%)	1.8		X Walk 2 Slope (%)	N/A			
			X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	N/A			
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A			
			Road Slope (%)	N/A	N/A	Clear Space?	Yes			
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A			
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No			
			Obstruction Type			Storm Grate/Utility Type				
					N/A		N/A			
					Yes	Surface Condition? (G/P)	Good			
Total Cost:		\$ 750.00								

Street 1 Name	SANDY ROCK PL
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

