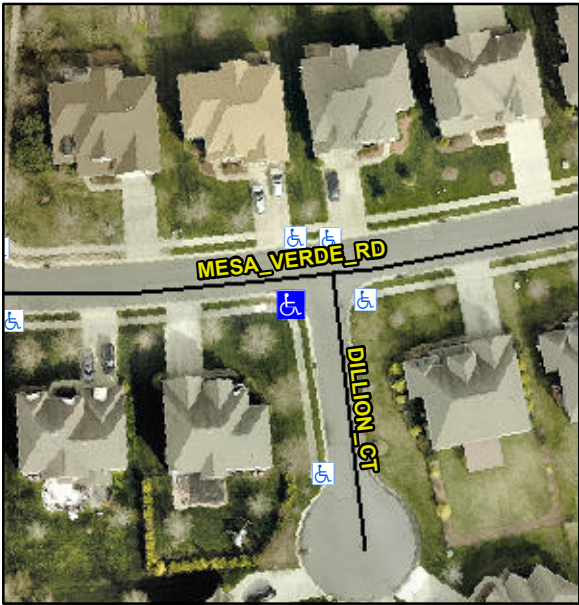


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 47967	Main Street: DILLION_CT	Cross Street: MESA_VERDE_RD	Location: SW
ADA ID: 78205160D853	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 8.75	

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
	Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.			N/A	Ramp Length (in)	50.0	Yes	Ramp Slope (%)	5.9
				No	Ramp Width (in)	47.0	Yes	Ramp XSlope (%)	1.4
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
				N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
				N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:	N/A			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
				N/A	Shared Landing?	N/A			
	PROW/ADA:			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
	Not Found, R304.5.1			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
				N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
					X Walk 1 Direction	To E		X Walk 2 Direction	To N
				N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
					X Walk 1 Slope (%)	1.6		X Walk 2 Slope (%)	5.5
					X Walk 1 X Slope (%)	2.3		X Walk 2 X Slope (%)	1.6
				N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	3.1	N/A	Clear Space?	N/A	
				Road X Slope (%)	6.1	N/A	Clear Space to XWalk (in)	N/A	
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
				Obstruction Type			Storm Grate/Utility Type		
						N/A		N/A	
						Yes	Surface Condition? (G/P)	Good	
Total Cost:			\$	3200.00					

Street 1 Name DILLION CT

Stop Condition-Street 2 StopSign

Street 2 Name MESA VERDE RD

Stop Condition-Street 1 None

