


Intersection ID: N/A	Main Street: PERIMETER_PY	Cross Street: N/A	Location:	NW
ADA ID: 786C222CD551	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 10.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.		N/A	Ramp Length (in)	77.0	Yes	Ramp Slope (%)	7.6
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.2
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	1.7	N/A	Flare Slope RT (%)	12.5
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
			No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
	Surveyor Notes:		No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
	N/A		No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.5
	PROW/ADA: Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para		No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A			Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0	
N/A			Shared Landing?	No				
Yes			Gutter Ponding?	No	Yes	Gutter Slope (%)	4.3	
Yes			Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.9	
N/A			Painted X Walk1?	Yes	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To S		X Walk 2 Direction	To E	
N/A			X Walk 1 Width (in)	71.0	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	3.9	
	X Walk 1 X Slope (%)	1.9		X Walk 2 X Slope (%)	2.4			
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A			
	Road Slope (%)	4.4	N/A	Clear Space?	Yes			
	Road X Slope (%)	1.0	N/A	Clear Space to XWalk (in)	N/A			
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No			
	Obstruction Type			Storm Grate/Utility Type				
Total Cost:		\$	3950.00	N/A		N/A		
					Yes	Surface Condition? (G/P)	Good	

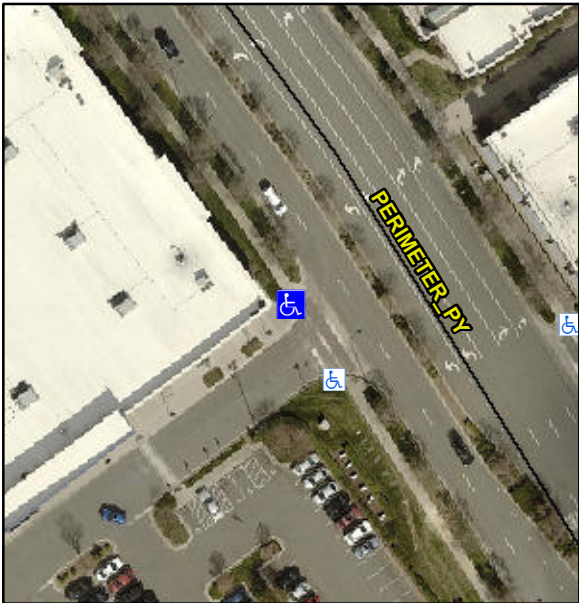