

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 15205	Main Street: CHEROKEE_RD	Cross Street: FENTON_PL	Location: E
ADA ID: 78EE149E94AB	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.75	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

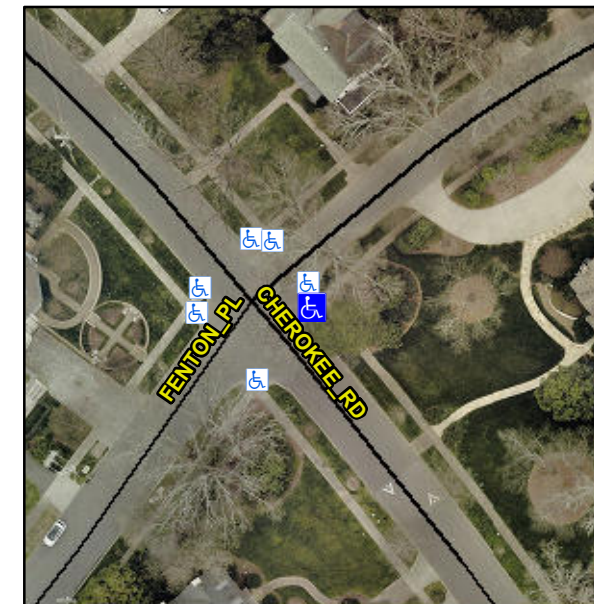

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,
R304.5.2, R305.1.4**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	78.0	No	Grade Break?	No
Yes	Ramp Width (in)	52.0	N/A	Grade Break Slope (%)	5.4
Yes	Ramp Slope (%)	5.8	N/A	Grade Break XSlope (%)	1.6
Yes	Ramp XSlope (%)	2.2			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	11.7	N/A	Flare Slope RT (%)	9.3
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	57.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	52.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.2	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.3	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	1.5
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	4.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.5
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.0
N/A	Painted X Walk1?	No		Road Slope (%)	4.4
	X Walk 1 Direction	To S		Road X Slope (%)	3.9
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	4.4	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	3.9	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	5.4

Total Cost: \$ 1600.00

