


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: IKEA_BV	Cross Street: N/A	Location: S
ADA ID: 792E8D6FF98E	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

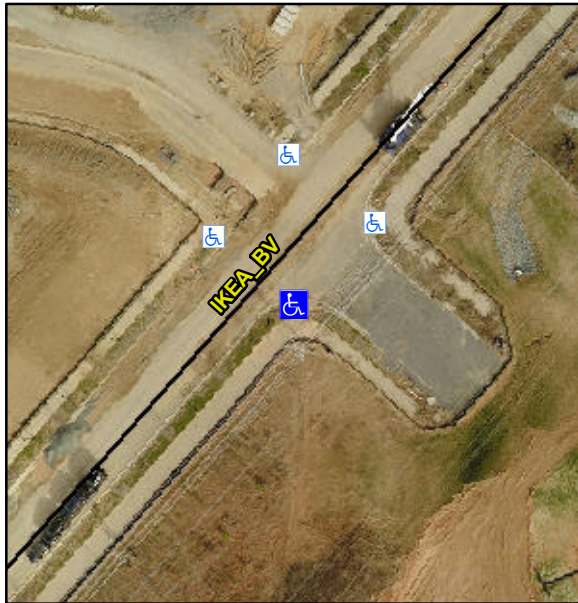

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R304.2.2-Perp, R304.3.2-Para, R302.7.2

Street 1 Name	IKEA BV
Stop Condition-Street 2	None
Street 2 Name	IKEA BV
Stop Condition-Street 1	None

Total Cost: \$ **3400.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	95.0	Yes	Ramp Slope (%)	6.8
Yes	Ramp Width (in)	59.0	No	Ramp XSlope (%)	3.6
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	5.7	N/A	Flare Slope RT (%)	8.7
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.4	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.3	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.0
No	Gutter Lip Ht (in)	2.6	Yes	Gutter X Slope (%)	0.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To W
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.5		X Walk 2 Slope (%)	1.8
	X Walk 1 X Slope (%)	2.6		X Walk 2 X Slope (%)	1.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.1	N/A	Clear Space?	Yes
	Road X Slope (%)	2.8	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

