


# Access Compliance Report

## Public Rights-of-Way (Curb Ramps)

Intersection ID: 52293	Main Street: N_I-85_SERVICE_RD	Cross Street: N_TRYON_ST	Location: W
ADA ID: 798994C913C0	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 7.5	

### Codes/Mitigation Info/Possible Solution

### Field Measurements/Component Compliance

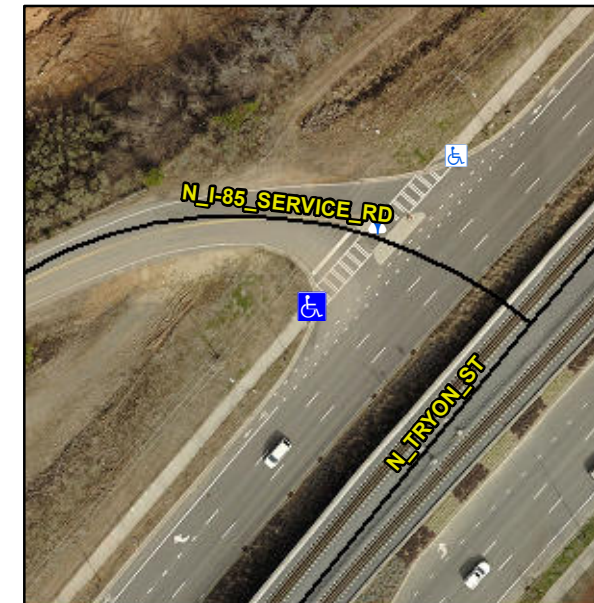

Possible Solutions:

**Remove & Replace Entire Ramp.  
Grind Gutter Lip.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.2, R302.7.2**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	82.0	No	Grade Break?	No
Yes	Ramp Width (in)	94.0	N/A	Grade Break Slope (%)	N/A
Yes	Ramp Slope (%)	5.2	N/A	Grade Break XSlope (%)	N/A
Yes	Ramp XSlope (%)	1.5			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	65.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	96.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.6	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.8	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	0.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	0.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.5
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.8
N/A	Painted X Walk1?	Yes		Road Slope (%)	0.4
	X Walk 1 Direction	To NE		Road X Slope (%)	0.9
	X Walk 1 Width (in)	122.0		Clear Space?	Yes
	X Walk 1 Slope (%)	0.4	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.9	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	N/A

Total Cost: \$ 1800.00

Street 1 Name	N I-85 SERVICE RD
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

