


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

| | | | |
|-----------------------|-------------------------|--------------------------|------------------------|
| Intersection ID: 8041 | Main Street: AUSTIN_DR | Cross Street: N_TRYON_ST | Location: W |
| ADA ID: 7A3B30635C3D | Ramp Type: Directional1 | Initial Pass/Fail: Pass | Overall Compliance: No |
| | | Severity Score: 15 | |

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

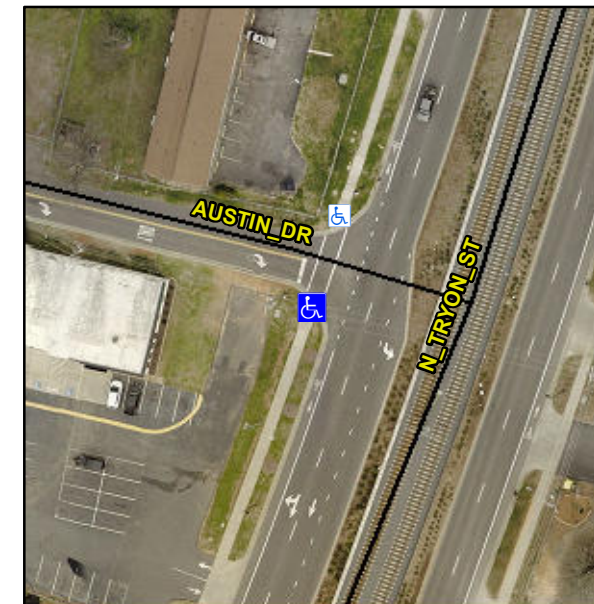

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter. Utility
Present.**

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.5.3, R305.2,
R302.7.2, R302.3, R402.2**

| Compliance | Description | Data | Compliance | Description | Data |
|------------|-----------------------|-------|------------|-----------------------------|--------------------|
| N/A | Ramp Length (in) | 137.0 | Yes | Grade Break? | Yes |
| Yes | Ramp Width (in) | 68.0 | Yes | Grade Break Slope (%) | 3.0 |
| Yes | Ramp Slope (%) | 7.6 | No | Grade Break XSlope (%) | 2.1 |
| Yes | Ramp XSlope (%) | 0.6 | | | |
| Yes | Flare Type LT | N/A | Yes | Flare Type RT | N/A |
| N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| N/A | Flare Traversable LT? | No | N/A | Flare Traversable RT? | No |
| Yes | Landing Length (in) | 61.0 | Yes | DWS Provided? | Yes |
| Yes | Landing Width (in) | 70.0 | Yes | DWS Contrast? | Yes |
| Yes | Landing Slope (%) | 0.2 | Yes | DWS Length (in) | 24.0 |
| Yes | Landing X Slope (%) | 1.7 | Yes | DWS Full Width? | Yes |
| N/A | Landing Curb? (Y/N) | N/A | No | DWS Offset LT (in) | 5.0 |
| N/A | Shared Landing? | No | Yes | DWS Offset RT (in) | 56.0 |
| Yes | Gutter Ponding? | No | Yes | Gutter Slope (%) | 2.5 |
| No | Gutter Lip Ht (in) | 0.8 | No | Gutter X Slope (%) | 3.3 |
| N/A | Painted X Walk1? | No | | Road Slope (%) | 0.8 |
| | X Walk 1 Direction | To N | | Road X Slope (%) | 3.1 |
| | X Walk 1 Width (in) | N/A | | Clear Space? | Yes |
| | X Walk 1 Slope (%) | 0.8 | N/A | Clear Space to XWalk (in) | N/A |
| | X Walk 1 X Slope (%) | 3.1 | No | Storm Grate/Utility Hazard? | Yes |
| N/A | Ramp inside XWalk1? | N/A | | Storm Grate/Utility Type | |
| Yes | Any Obstructions? | No | | | GAS VAL GTR |
| | Obstruction Type | | Yes | Surface Condition? (G/P) | Good |
| | | | N/A | Curb Slope (%) | 9.3 |

Total Cost: \$ 7350.00

