

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 7375	Main Street: TRYON_ST	Cross Street: TOM_HUNTER_RD	Location: SE
ADA ID: 7AE7AA2EEC2A	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

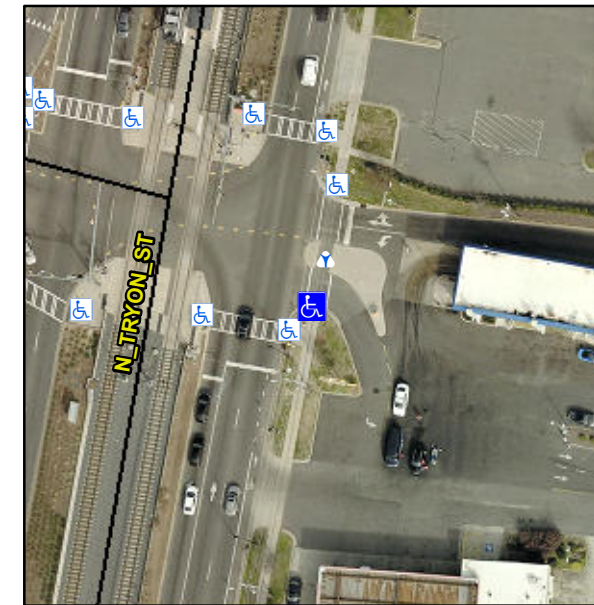

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.2, R305.2**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	98.0	No	Grade Break?	No
Yes	Ramp Width (in)	68.0	N/A	Grade Break Slope (%)	N/A
Yes	Ramp Slope (%)	3.3	N/A	Grade Break XSlope (%)	N/A
Yes	Ramp XSlope (%)	2.0			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	71.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.6	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	2.0	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	3.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	3.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.0
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	Yes		Road Slope (%)	1.8
	X Walk 1 Direction	To N		Road X Slope (%)	2.8
	X Walk 1 Width (in)	120.0		Clear Space?	Yes
	X Walk 1 Slope (%)	1.8	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.8	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	6.3

Total Cost: \$ 1600.00

Street 1 Name	<b>ENTRANCE</b>
Stop Condition-Street 1	<b>Signal</b>
Street 2 Name	<b>N/A</b>
Stop Condition-Street 2	<b>N/A</b>

