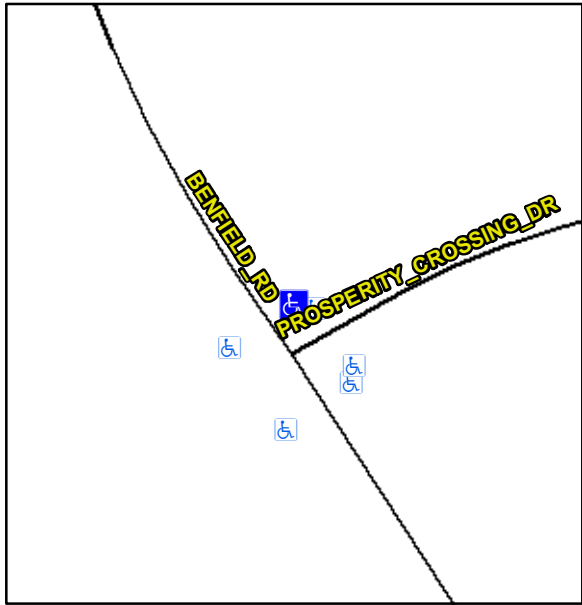


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 49102		Main Street: PROSPERITY_CROSSING_DR		Cross Street: BENFIELD_RD		Location: N											
ADA ID: 7AEEF49F6F38		Ramp Type: Directional1		Initial Pass/Fail: Pass		Overall Compliance: No		Severity Score: 5.25									
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance													
<div></div> <div>Street 1 NameBENFIELD RD</div> <div>Stop Condition-Street 1None</div> <div>Street 2 NameN/A</div> <div>Stop Condition-Street 2N/A</div>				Possible Solutions:		Compliance		Description		Data		Compliance		Description		Data	
				Remove & Replace Gutter.		N/A	Ramp Length (in)	69.0		Yes	Grade Break?	Yes					
						Yes	Ramp Width (in)	71.5		Yes	Grade Break Slope (%)	1.8					
						Yes	Ramp Slope (%)	1.2		Yes	Grade Break XSlope (%)	3.2					
						Yes	Ramp XSlope (%)	3.0									
						N/A	Flare Type LT	N/A		N/A	Flare Type RT	N/A					
						N/A	Flare Slope LT (%)	N/A		N/A	Flare Slope RT (%)	N/A					
						N/A	Flare Traversable LT?	N/A		N/A	Flare Traversable RT?	N/A					
						Yes	Landing Length (in)	71.0		Yes	DWS Provided?	Yes					
						Yes	Landing Width (in)	70.0		Yes	DWS Contrast?	Yes					
		Yes	Landing Slope (%)	0.2		Yes	DWS Length (in)	24.0									
		Yes	Landing X Slope (%)	1.7		Yes	DWS Full Width?	Yes									
		N/A	Landing Curb? (Y/N)	No		Yes	DWS Offset LT (in)	22.0									
		N/A	Shared Landing?	Yes		Yes	DWS Offset RT (in)	1.0									
		Yes	Gutter Ponding?	No		No	Gutter Slope (%)	5.3									
		Yes	Gutter Lip Ht (in)	0.0		Yes	Gutter X Slope (%)	3.7									
		N/A	Painted X Walk1?	No			Road Slope (%)	0.3									
			X Walk 1 Direction	To SW			Road X Slope (%)	3.7									
			X Walk 1 Width (in)	N/A			Clear Space?	Yes									
			X Walk 1 Slope (%)	0.3		N/A	Clear Space to XWalk (in)	N/A									
			X Walk 1 X Slope (%)	3.7		Yes	Storm Grate/Utility Hazard?	No									
		N/A	Ramp inside XWalk1?	N/A			Storm Grate/Utility Type										
		Yes	Any Obstructions?	No				N/A									
			Obstruction Type			Yes	Surface Condition? (G/P)	Good									
						N/A	Curb Slope (%)	1.3									
		Surveyor Notes:															
		N/A															
		PROW/ADA:															
		R304.5.4															
		Total Cost:		\$	750.00												

Street 1 Name	BENFIELD RD
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

