


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 44555	Main Street: UNIVERSITY_CITY_BV	Cross Street: N_TRYON_ST	Location: NW
ADA ID: 7B5C3D9D9C53	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 20			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

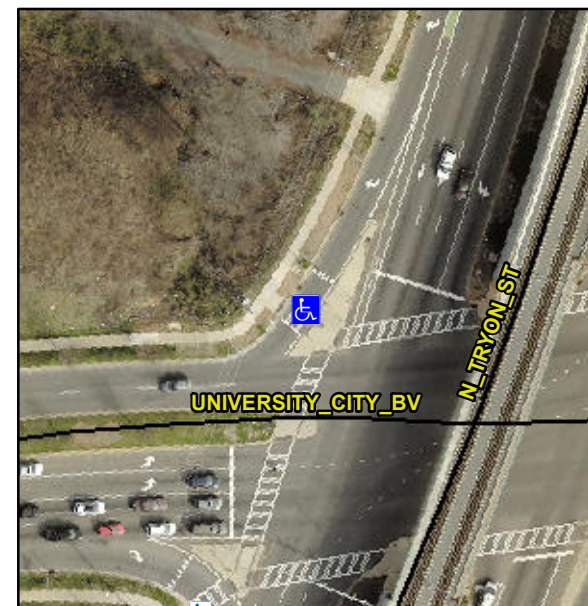

Possible Solutions:

**Remove & Replace Entire Ramp.
Grind Gutter Lip.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,
R304.2.3, R302.7, R302.7.2**

Street 1 Name **N TRYON ST**
 Stop Condition-Street 2 **YieldSign**
 Street 2 Name **N/A**
 Stop Condition-Street 1 **N/A**

Total Cost: \$ **2050.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	88.0	Yes	Ramp Slope (%)	7.4
Yes	Ramp Width (in)	94.0	Yes	Ramp XSlope (%)	0.2
No	Flare Type	Curbed_WithWalkSurface	Yes	Flare Type RT	N/A
No	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	81.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	94.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	4.1	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.6	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	1.6
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	0.3
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	120.5	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.9		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.0		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

