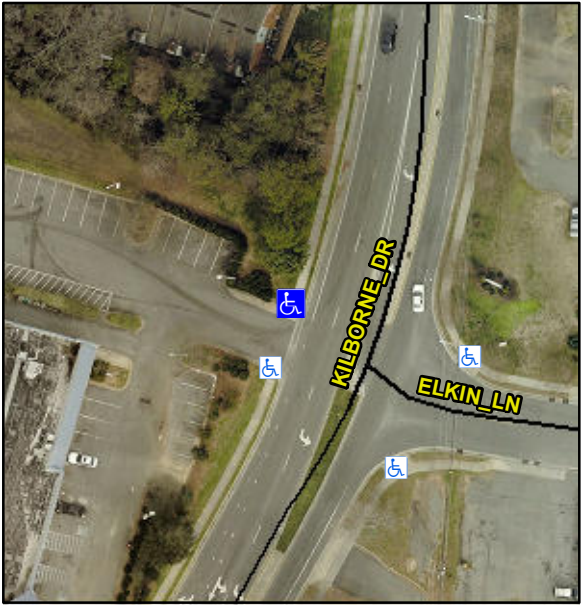


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: ELKIN_LN	Cross Street: KILBORNE_DR	Location: NW
ADA ID: 7B715D1308A4	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Entire Ramp.</b>		N/A	Ramp Length (in)	121.0
			Yes	Ramp Width (in)	60.0
			No	Ramp Slope (%)	9.7
			Yes	Ramp XSlope (%)	1.4
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	0.0
<p>Surveyor Notes:</p> <p><b>N/A</b></p>			N/A	Grade Break?	N/A
			N/A	Grade Break Slope (%)	0.0
			N/A	Grade Break XSlope (%)	0.0
			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	0.0
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
<p>PROW/ADA:</p> <p><b>R304.2.2</b></p>			N/A	DWS Offset LT (in)	N/A
			N/A	DWS Offset RT (in)	N/A
			N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Gutter X Slope (%)	N/A
			N/A	Road Slope (%)	0.6
			N/A	Road X Slope (%)	8.7
			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
<p>Total Cost:</p> <p><b>\$ 1600.00</b></p>			N/A	Storm Grate/Utility Type	N/A
			N/A	Obstruction Type	N/A
			N/A	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	2.2
			N/A		
			N/A		
			N/A		
			N/A		
			N/A		
			N/A		

Street 1 Name	<b>ENTRANCE</b>
Stop Condition-Street 1	<b>None</b>
Street 2 Name	<b>N/A</b>
Stop Condition-Street 2	<b>N/A</b>

