

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 19822	Main Street: CHITAL_RD	Cross Street: THORNFIELD_RD	Location: SE
ADA ID: 7CEB9BE02B0C	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 10	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

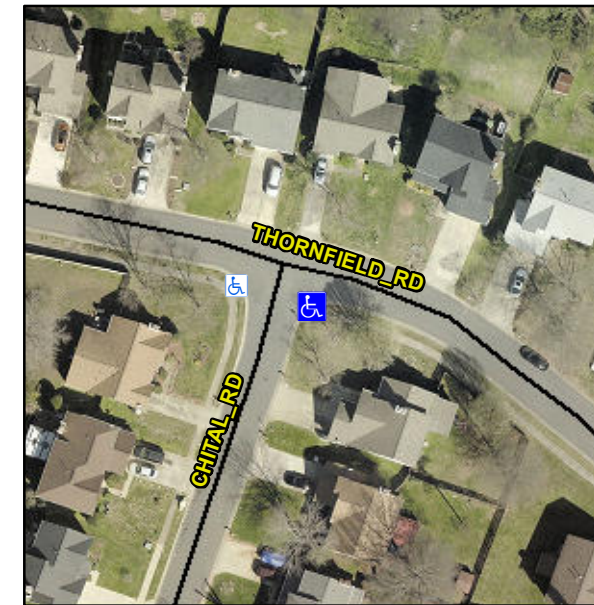

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.1, R305

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	42.0	Yes	BlendTrans Slope (%)	4.2
Yes	Ramp Width (in)	52.0	Yes	BlendTrans XSlope (%)	0.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	1.8	N/A	Flare Slope RT (%)	3.5
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	43.0	No	DWS Provided?	No
Yes	Landing Width (in)	48.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.1	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	0.8	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.5
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	6.4		X Walk 2 Slope (%)	7.0
	X Walk 1 X Slope (%)	5.2		X Walk 2 X Slope (%)	1.7
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.1		Clear Space?	Yes
	Road X Slope (%)	7.9	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	15.1

Street 1 Name THORNFIELD RD

Stop Condition-Street 1 None

Street 2 Name CHITAL RD

Stop Condition-Street 2 StopSign

