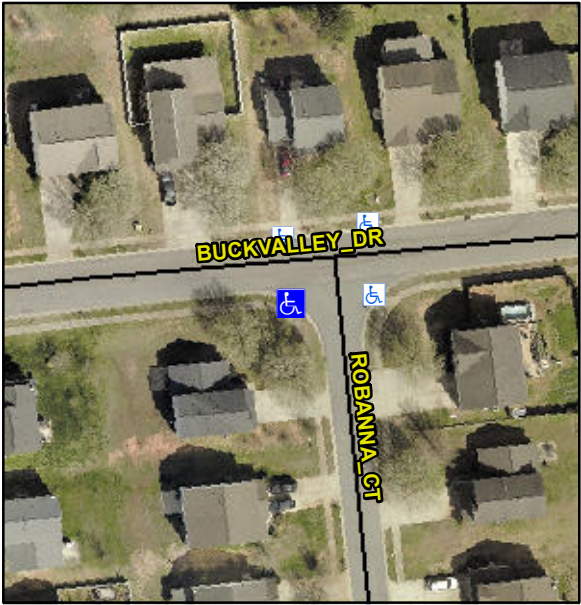


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 29375	Main Street: BUCKVALLEY_DR	Cross Street: ROBANNA_CT	Location: SW
ADA ID: 7D310D634FB8	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 33.75			

	Possible Solutions:	Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	N/A	Ramp Length (in)	95.5	Yes	Ramp Slope (%)	6.8
		No	Ramp Width (in)	42.0	No	Ramp XSlope (%)	7.9
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.5.1, R304.5.3</p>		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
			X Walk 1 Direction	To E		X Walk 2 Direction	To N
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	2.9		X Walk 2 Slope (%)	4.0
			X Walk 1 X Slope (%)	6.1		X Walk 2 X Slope (%)	7.0
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
<p>Street 1 Name</p> <p>Stop Condition-Street 2</p> <p>Street 2 Name</p> <p>Stop Condition-Street 1</p>			Road Slope (%)	7.8	N/A	Clear Space?	N/A
			Road X Slope (%)	1.1	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
					N/A		N/A
					Yes	Surface Condition? (G/P)	Good
Total Cost:		\$	3200.00				

