


## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Intersection ID: 20090 Main Street: OLD\_PINEVILLE\_RD **Cross Street: LAKEMIST\_DR** Location: NW **Overall Compliance: No** ADA ID: 7D8242F5A94E Ramp Type: PerpDiag Initial Pass/Fail: Fail Severity Score: 21.25

Codes/Mitigation Info/Po

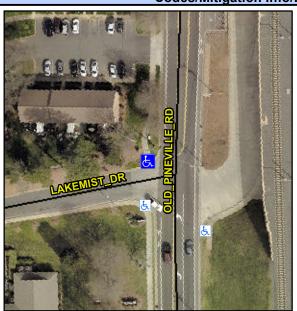

Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1

**LAKEMIST DR** StopSign **OLD PINEVILLE RD** None

Possible Solution							
Possible Solutions:							
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.							
Surveyor Notes:	ı						
N/A	! !						
PROW/ADA:	i						
Not Found, R304.5.1, R304.2.2	1						
	ı						

Total Cost: 3200.00

Field Measurements/Component Compliance								
	Compliance Description		Data	Compliance Description		Data		
	N/A	Ramp Length (in)	59.5	No	Ramp Slope (%)	8.6		
	No	Ramp Width (in)	47.5	Yes	Ramp XSlope (%)	1.9		
	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
	N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
	N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
	N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
	N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
	N/A	Shared Landing?	N/A					
	N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A		
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No		
		X Walk 1 Direction	To S		X Walk 2 Direction	To E		
	N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
		X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	5.5		
		X Walk 1 X Slope (%)	2.1		X Walk 2 X Slope (%)	1.1		
	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
		Road Slope (%)	2.6	N/A	Clear Space?	N/A		
		Road X Slope (%)	5.7	N/A	Clear Space to XWalk (in)	N/A		
	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
		Obstruction Type			Storm Grate/Utility Type			
			N/A			N/A		
				Yes	Surface Condition? (G/P)	Good		
T 10 10								





