

Access Compliance Report Public Rights-of-Way (Curb Ramps)



N/A

Good

Surface Condition? (G/P)


Intersection ID: 49689 Main Street: ALEXANDER_ALLEY_DR Cross Street: SHARON_HILLS_RD Location: N

ADA ID: 7DD64F8434C4 Ramp Type: PerpDiag Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 2.75

Codes/Mitigation Info/Possible Solution

Possible Solutions:

Field Measurements/Component Compliance

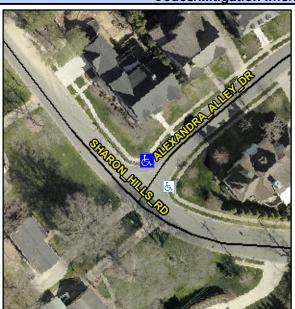

Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

SHARON HILLS RD None ALEXANDER ALLEY DR StopSign Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:
N/A

PROW/ADA:
Not Found, R304.5.3, R304.2.2-Perp, R304.3.2-Para, R304.2.3

Total Cost: \$ 3950.00

Comp	Compliance Description		Compliance		Description	Data
N/A	Ramp Length (in)	49.0	Yes	Ramp	Slope (%)	7.5
Yes	Ramp Width (in)	48.0	No	Ramp	XSlope (%)	4.8
N/A	Flare Type LT	Sloped	N/A	Flare	Type RT	N/A
N/A	Flare Slope LT (%)	0.9	No	Flare	Slope RT (%)	10.6
N/A	Flare Traversable LT?	Yes	N/A	Flare	Traversable RT?	Yes
Yes	Landing Length (in)	49.0	Yes	DWS	Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS	Contrast?	Yes
No	Landing Slope (%)	2.2	Yes	DWS	Length (in)	24.5
No	Landing X Slope (%)	5.3	Yes	DWS	Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS	Offset (in)	0.0
N/A	Shared Landing?	No				
Yes	Gutter Ponding?	No	Yes	Gutte	r Slope (%)	0.4
Yes	Gutter Lip Ht (in)	0.0	No	Gutte	r X Slope (%)	3.3
N/A	Painted X Walk1?	No	N/A	Paint	ed X Walk2?	No
	X Walk 1 Direction	To SW		X Wa	lk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Wa	lk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.1		X Wa	lk 2 Slope (%)	2.1
	X Walk 1 X Slope (%)	0.8		X Wa	lk 2 X Slope (%)	3.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ram	inside XWalk2?	N/A
	Road Slope (%)	3.8	N/A	Clear	Space?	Yes
	Road X Slope (%)	2.6	N/A	Clear	Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storn	n Grate/Utility Hazard?	No
	Obstruction Type			Storn	n Grate/Utility Type	





