


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 42369	Main Street: BENTGRASS_RUN_DR	Cross Street: LYLETON_LN	Location: S
ADA ID: 7DECA5B3452F	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 10			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

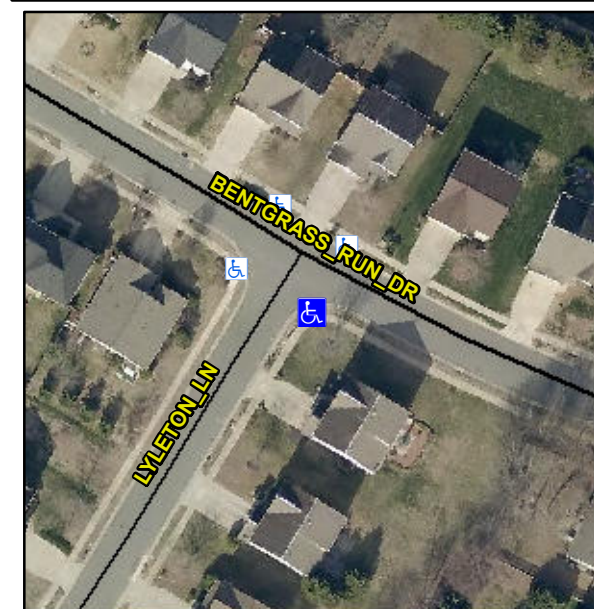

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.1, R305**

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	41.0	Yes	Ramp Slope (%)	5.9
Yes	Ramp Width (in)	96.0	Yes	Ramp XSlope (%)	1.9
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	7.9	N/A	Flare Slope RT (%)	4.2
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	46.5	No	DWS Provided?	No
Yes	Landing Width (in)	92.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	0.2	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	0.3	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.7
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.5		X Walk 2 Slope (%)	0.4
	X Walk 1 X Slope (%)	0.4		X Walk 2 X Slope (%)	1.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.8	N/A	Clear Space?	Yes
	Road X Slope (%)	0.5	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

