


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 12618	Main Street: E_5TH_ST	Cross Street: N_CALDWELL_ST	Location: NW
ADA ID: 7E3E27821485	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

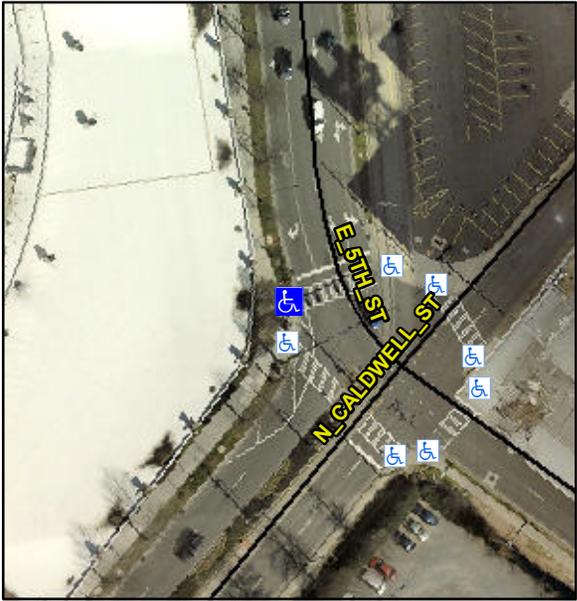

Possible Solutions:
**Remove & Replace Entire Ramp.
 Remove & Replace Gutter.**

Surveyor Notes:
N/A

PROW/ADA:
Not Found, R304.2.1, R304.5.3

Street 1 Name **E 5TH ST**
 Stop Condition-Street 2 **Signal**
 Street 2 Name **N/A**
 Stop Condition-Street 1 **N/A**

Total Cost: \$ **2600.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	52.0	Yes	Ramp Slope (%)	6.5
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	4.7	N/A	Flare Slope RT (%)	8.9
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
No	Landing Length (in)	45.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.4	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.4	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.7
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.4
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	116.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.7		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.3		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

