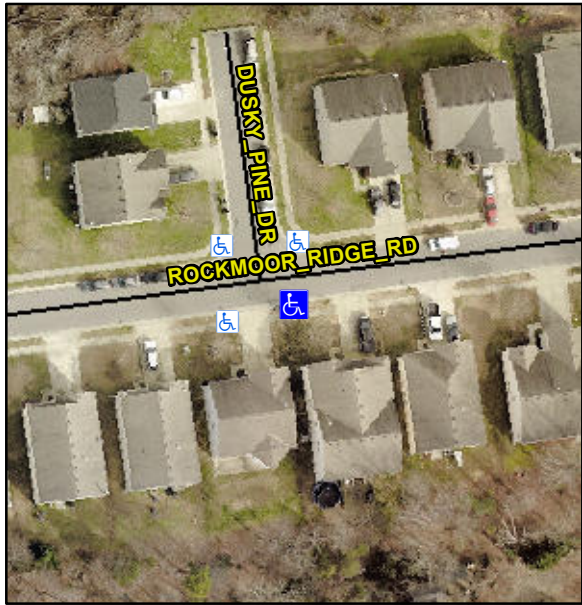


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 47817	Main Street: DUSKY_PINE_DR	Cross Street: ROCKMOOR_RIDGE_RD	Location: SE
ADA ID: 7E467E005C3A	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 12.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		Compliance			Description			Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	5.2		
	Remove & Replace Gutter.		Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.7		
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	4.6	N/A	Flare Slope RT (%)	0.5		
			N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No		
			Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes		
			Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes		
			Yes	Landing Slope (%)	1.9	Yes	DWS Length (in)	24.5		
			No	Landing X Slope (%)	3.0	Yes	DWS Full Width?	Yes		
Surveyor Notes:		N/A			Yes			DWS Offset (in)	0.0	
PROW/ADA:		Not Found, R304.5.3, R302.7, R302.7.2, R304.5.4			No			Shared Landing?	No	
					No			Gutter Ponding?	Yes	
					No			Gutter Lip Ht (in)	0.5	
					N/A			Painted X Walk1?	No	
					To N			X Walk 1 Direction	N/A	
					N/A			X Walk 1 Width (in)	N/A	
					1.3			X Walk 1 Slope (%)	N/A	
					2.1			X Walk 1 X Slope (%)	N/A	
					N/A			Ramp inside XWalk1?	N/A	
					N/A			Road Slope (%)	N/A	
					N/A			Road X Slope (%)	N/A	
		Yes			No			Any Obstructions?	Yes	
								Obstruction Type	N/A	
									N/A	
					Yes			Surface Condition? (G/P)	Good	

Street 1 Name	ROCKMOOR RIDGE RD
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

