


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 3125	Main Street: JOHNSTON_OEHLER_RD	Cross Street: MOURNING_DOVE_LN	Location: SE
ADA ID: 7EAD9A447836	Ramp Type: Combination1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 5.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

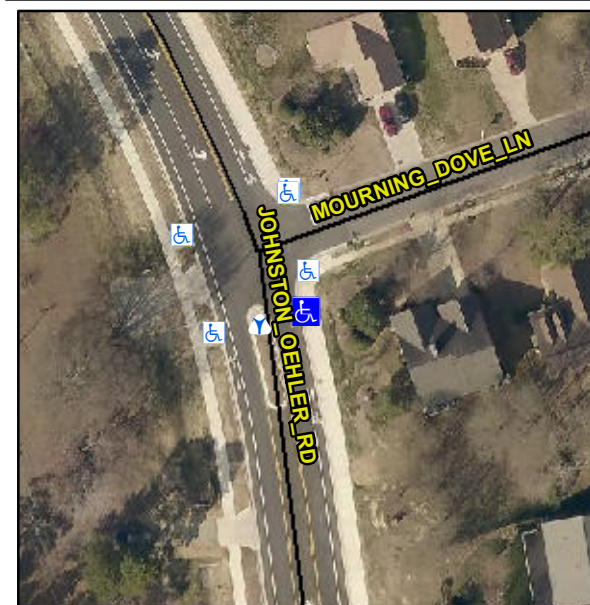

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

RT RP < 5%

PROW/ADA:

R304.5.3, R304.2.2-Perp, R304.3.2-Para, R304.2.3

Street 1 Name	None
Stop Condition-Street 1	JOHNSTON OEHLER RD
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 1800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	68.0	N/A	Ramp Length RT (in)	67.0
Yes	Ramp Width LT (in)	63.0	Yes	Ramp Width RT (in)	63.0
Yes	Ramp Slope LT (%)	7.4	Yes	Ramp Slope RT (%)	4.5
No	Ramp XSlope LT (%)	3.5	Yes	Ramp XSlope RT (%)	1.6
N/A	Ramp Length (in)	27.0	Yes	Ramp Slope (%)	7.8
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.6
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
No	Flare Slope LT (%)	12.6	Yes	Flare Slope RT (%)	7.1
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	63.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.2	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.4	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	Yes			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.5
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.6
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.0		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstruction?	No
				Obstruction Type	N/A
			Yes	Storm Grate/Utility Hazard?	No
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	N/A

