


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: LOG_CABIN_RD	Cross Street: SQUIRREL_HILL_RD	Location: SE
ADA ID: 7EC68F8A3F04	Ramp Type: Combination2Diag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

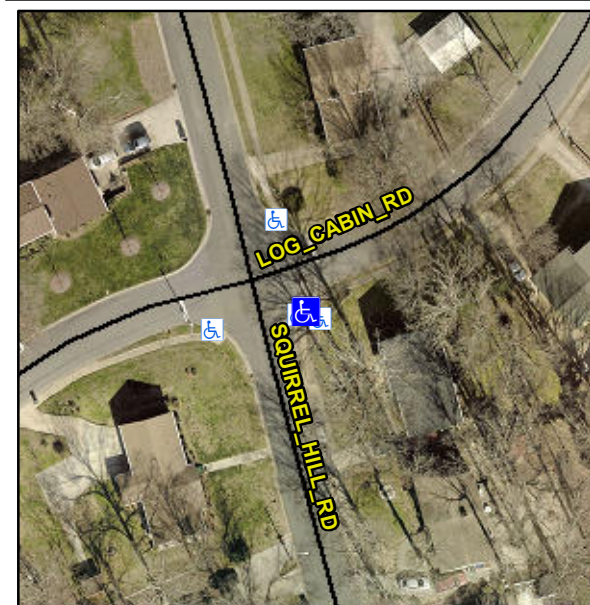

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.5.1, R304.5.3, R304.3.2

Street 1 Name	StopSign
Stop Condition-Street 1	LOG CABIN RD
Street 2 Name	None
Stop Condition-Street 2	SQUIRREL HILL RD

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	21.5	N/A	Ramp Length RT (in)	20.5
No	Ramp Width LT (in)	47.0	No	Ramp Width RT (in)	47.5
Yes	Ramp Slope LT (%)	2.4	No	Ramp Slope RT (%)	10.8
No	Ramp XSlope LT (%)	3.8	No	Ramp XSlope RT (%)	3.8
N/A	Ramp Length (in)	12.0	Yes	Ramp Slope (%)	7.9
No	Ramp Width (in)	44.0	No	Ramp XSlope (%)	6.3
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.2		X Walk 2 Slope (%)	7.6
	X Walk 1 X Slope (%)	7.9		X Walk 2 X Slope (%)	0.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	5.4		Clear Space?	N/A
	Road X Slope (%)	5.6	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
Yes	Surface Condition? (G/P)	Good			
	Curb Slope (%)	25.6			

