


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 10038264	Main Street: SMITH_RD	Cross Street: N/A	Location: NW
ADA ID: 7F9B79C7D453	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		No	Ramp Length (in)	95.0
			Yes	Ramp Width (in)	195.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
Surveyor Notes: N/A PROW/ADA: Not Found, R304.2.2, R304.5.3			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
Total Cost: \$ 1850.00			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
			To SE	X Walk 2 Direction	N/A
			N/A	X Walk 2 Width (in)	N/A
			4.2	X Walk 2 Slope (%)	N/A
			2.9	X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A
			N/A	Ramp inside XWalk2?	N/A
			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
Obstruction Type N/A			N/A	Storm Grate/Utility Hazard?	N/A
			N/A	Storm Grate/Utility Type	N/A
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

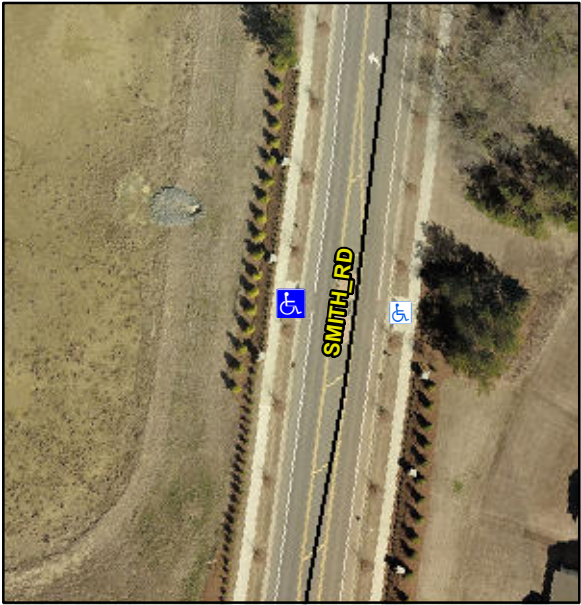