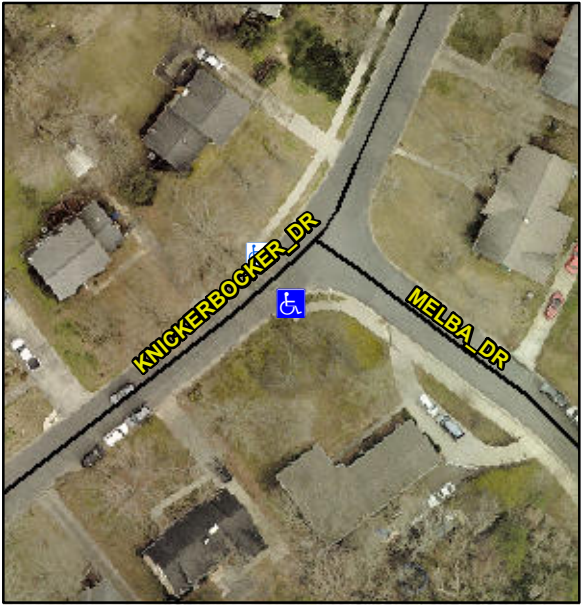


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 17587	Main Street: KNICKERBOCKER_DR	Cross Street: MELBA_DR	Location: S
ADA ID: 7FA8F565DB00	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:	Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp. Remove & Replace Gutter.	N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	5.1
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.3</p>		Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.3
		N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	6.8	Yes	Flare Slope RT (%)	2.1
		N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
		Yes	Landing Length (in)	58.0	Yes	DWS Provided?	Yes
		Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
		Yes	Landing Slope (%)	1.3	Yes	DWS Length (in)	24.0
		Yes	Landing X Slope (%)	1.9	Yes	DWS Full Width?	Yes
		N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
		N/A	Shared Landing?	No			
		Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.2
		Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.1
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
			X Walk 1 Direction	To N		X Walk 2 Direction	N/A
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	2.3		X Walk 2 Slope (%)	N/A
			X Walk 1 X Slope (%)	0.5		X Walk 2 X Slope (%)	N/A
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	N/A	N/A	Clear Space?	Yes
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
			Obstruction Type			Storm Grate/Utility Type	
					N/A		N/A
					Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 2600.00

