


Intersection ID: 10033966		Main Street: PARK_RD		Cross Street: N/A		Location:		SW													
ADA ID: 7FDF46BDC5A0		Ramp Type: ParaDiag		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 26.25													
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance																	
		Possible Solutions:		Compliance		Description		Data		Compliance		Description		Data							
		Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A		Ramp Length LT (in)		64.0		N/A		Ramp Length RT (in)		60.0							
				Yes		Ramp Width LT (in)		60.0		Yes		Ramp Width RT (in)		60.0							
				Yes		Ramp Slope LT (%)		2.9		No		Ramp Slope RT (%)		19.2							
				No		Ramp XSlope LT (%)		2.8		No		Ramp XSlope RT (%)		2.6							
				N/A		Landing Length (in)		N/A		N/A		DWS Provided?		N/A							
				N/A		Landing Width (in)		N/A		N/A		DWS Contrast?		N/A							
				N/A		Landing Slope (%)		N/A		N/A		DWS Length (in)		N/A							
				N/A		Landing X Slope (%)		N/A		N/A		DWS Full Width?		N/A							
				N/A		Landing Curb? (Y/N)		N/A		N/A		DWS Offset (in)		N/A							
<p>Surveyor Notes:</p> <p>LT RP < 5%</p> <p>PROW/ADA:</p> <p>R304.5.3, R304.3.2</p>				N/A		Shared Landing?		N/A				N/A		Gutter Slope (%)		N/A					
				N/A		Gutter Ponding?		N/A		N/A		Gutter X Slope (%)		N/A		N/A		Gutter Slope (%)		N/A	
				N/A		Gutter Lip Ht (in)		N/A		N/A		Gutter X Slope (%)		N/A		N/A		Gutter X Slope (%)		N/A	
				N/A		Painted X Walk1?		No		N/A		Painted X Walk2?		No		N/A		Painted X Walk2?		No	
						X Walk 1 Direction		To E				X Walk 2 Direction		To N				X Walk 2 Direction		To N	
				N/A		X Walk 1 Width (in)		N/A		N/A		X Walk 2 Width (in)		N/A				X Walk 2 Width (in)		N/A	
						X Walk 1 Slope (%)		4.6				X Walk 2 Slope (%)		4.9				X Walk 2 Slope (%)		4.9	
						X Walk 1 X Slope (%)		7.7				X Walk 2 X Slope (%)		5.5				X Walk 2 X Slope (%)		5.5	
				N/A		Ramp inside XWalk1?		N/A		N/A		Ramp inside XWalk2?		N/A				Ramp inside XWalk2?		N/A	
						Road Slope (%)		8.3		N/A		Clear Space?		N/A				Clear Space?		N/A	
<p>Total Cost:</p> <p>\$ 3200.00</p>						Road X Slope (%)		1.2		N/A		Clear Space to XWalk (in)		N/A				Clear Space to XWalk (in)		N/A	
				N/A		Any Obstructions?		N/A		N/A		Storm Grate/Utility Hazard?		N/A				Storm Grate/Utility Hazard?		N/A	
						Obstruction Type						Storm Grate/Utility Type						Storm Grate/Utility Type			
								N/A						N/A						N/A	
										Yes		Surface Condition? (G/P)		Good				Surface Condition? (G/P)		Good	
										N/A		Curb Slope (%)		10.1				Curb Slope (%)		10.1	

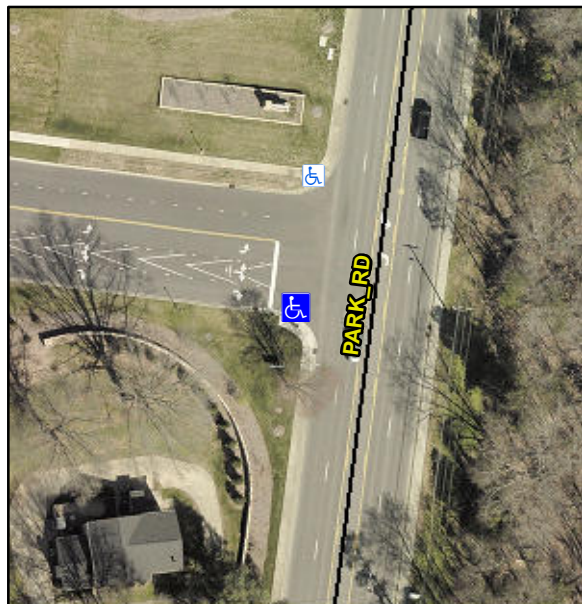