


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 3906		Main Street: BROWNE'S_FERRY_RD		Cross Street: KIRKGARD_TL		Location: S													
ADA ID: 8015AAE6CAB1		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 8.75											
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance															
				Possible Solutions:		Compliance		Description		Data		Compliance		Description		Data			
				Remove & Replace Entire Ramp.		N/A		N/A		Ramp Length (in)		47.0		N/A		Grade Break?		N/A	
Surveyor Notes:				N/A		N/A		No		Ramp Width (in)		45.5		N/A		Grade Break Slope (%)		0.0	
								Yes		Ramp Slope (%)		7.3		N/A		Grade Break XSlope (%)		0.0	
PROW/ADA:				R304.5.1		N/A		Yes		Ramp XSlope (%)		1.3		N/A		Flare Type RT		N/A	
								N/A		Flare Type LT		N/A		N/A		Flare Slope RT (%)		0.0	
Total Cost:				\$ 1600.00		N/A		N/A		Flare Slope LT (%)		N/A		N/A		Flare Traversable RT?		N/A	
								N/A		Flare Traversable LT?		N/A		N/A		DWS Provided?		N/A	
						N/A		N/A		Landing Length (in)		0.0		N/A		DWS Contrast?		N/A	
								N/A		Landing Width (in)		0.0		N/A		DWS Length (in)		N/A	
						N/A		N/A		Landing Slope (%)		0.0		N/A		DWS Full Width?		N/A	
								N/A		Landing X Slope (%)		0.0		N/A		DWS Offset LT (in)		N/A	
						N/A		N/A		Landing Curb? (Y/N)		N/A		N/A		DWS Offset RT (in)		N/A	
								N/A		Shared Landing?		N/A		N/A		Gutter Slope (%)		N/A	
						N/A		N/A		Gutter Ponding?		0.0		N/A		Gutter X Slope (%)		N/A	
								N/A		Gutter Lip Ht (in)		0.0		N/A		Road Slope (%)		0.5	
						N/A		N/A		Painted X Walk1?		No				Road X Slope (%)		0.5	
								N/A		X Walk 1 Direction		To NE				Clear Space?		N/A	
						N/A		N/A		X Walk 1 Width (in)		N/A		N/A		Clear Space to XWalk (in)		N/A	
								N/A		X Walk 1 Slope (%)		0.5		N/A		Storm Grate/Utility Hazard?		N/A	
						N/A		N/A		X Walk 1 X Slope (%)		0.5		N/A		Storm Grate/Utility Type			
								N/A		Ramp inside XWalk1?		N/A				Storm Grate/Utility Type			
						N/A		N/A		Any Obstructions?		N/A				N/A			
								N/A		Obstruction Type		Yes		Surface Condition? (G/P)		Good			
						N/A		N/A		N/A		N/A		Curb Slope (%)		7.5			
								N/A		N/A		N/A		N/A		N/A		N/A	

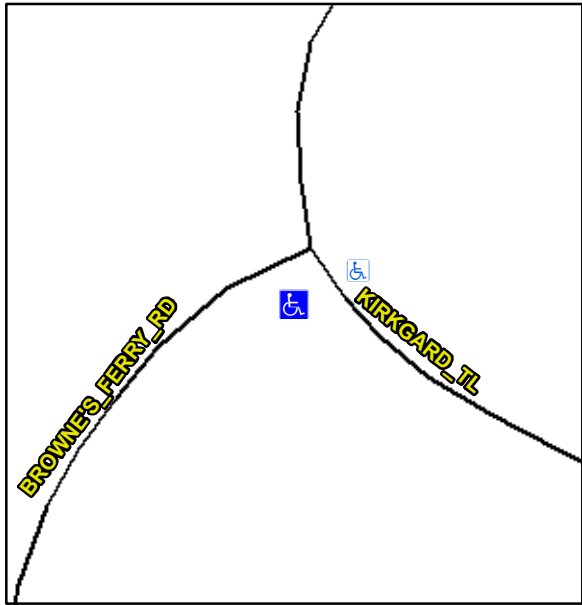