


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10033675	Main Street: ORCHARD_LAKE_DR	Cross Street: N/A	Location: SW
ADA ID: 804060875BED	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 2.5			

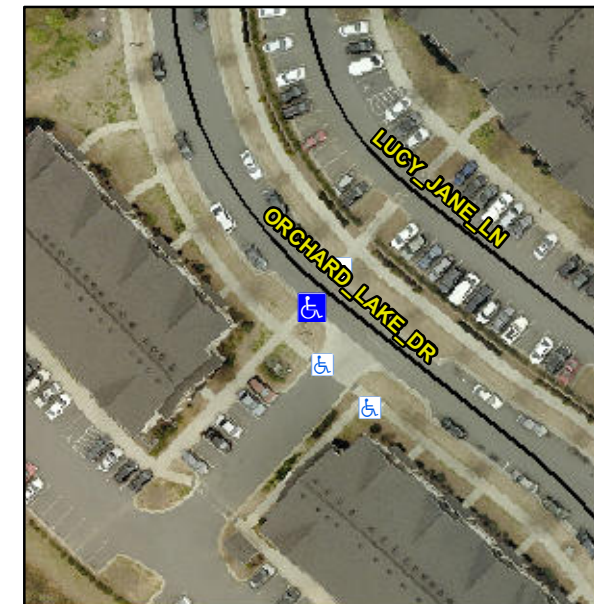

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.2-Perp, R304.3.2-Para, R305.1.4**

Total Cost: \$ 1850.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	86.0	Yes	Ramp Slope (%)	7.1
Yes	Ramp Width (in)	72.0	Yes	Ramp XSlope (%)	1.9
N/A	Flare Type LT	None	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	87.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	72.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.8	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.8	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.5
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.3
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.6		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name ORCHARD LAKE DR

Stop Condition-Street 2 None

Street 2 Name N/A

Stop Condition-Street 1 N/A

