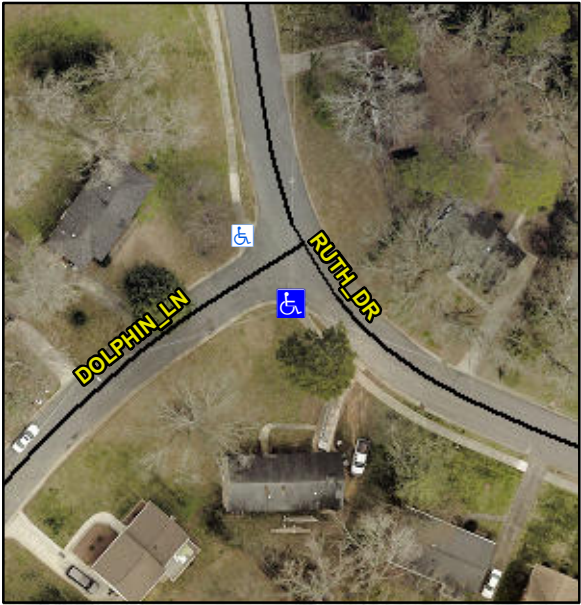


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10121	Main Street: DOLPHIN_LN	Cross Street: RUTH_DR	Location:	S
ADA ID: 805540C0603A	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	85.0	N/A
			Yes	Ramp Width (in)	60.0	N/A
			No	Ramp Slope (%)	13.5	N/A
			Yes	Ramp XSlope (%)	1.4	N/A
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Landing Length (in)	0.0	N/A
			N/A	Landing Width (in)	0.0	N/A
			N/A	Landing Slope (%)	0.0	N/A
			N/A	Landing X Slope (%)	0.0	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A
			N/A	Shared Landing?	N/A	N/A
			N/A	Gutter Ponding?	0.0	N/A
			N/A	Gutter Lip Ht (in)	0.0	N/A
			N/A	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To NW	N/A
				X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	3.8	N/A
				X Walk 1 X Slope (%)	1.9	N/A
Surveyor Notes: N/A			N/A	Ramp inside XWalk1?	N/A	N/A
			N/A	Any Obstructions?	N/A	N/A
PROW/ADA: R304.2.2				Obstruction Type		
			Yes	Surface Condition? (G/P)		Good
			N/A	Curb Slope (%)		7.8
Street 1 Name	DOLPHIN LN					
Stop Condition-Street 1	StopSign					
Street 2 Name	N/A					
Stop Condition-Street 2	N/A					
Total Cost:	\$	1600.00				

