


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 25251 Main Street: JOHNSTON_RD Cross Street: OAKBROOK_DR Location: NW **Overall Compliance: No** ADA ID: 80A848256654 Ramp Type: Perp Initial Pass/Fail: Fail **Severity Score:** 25

Codes/Mitigation Info/Possible Solution

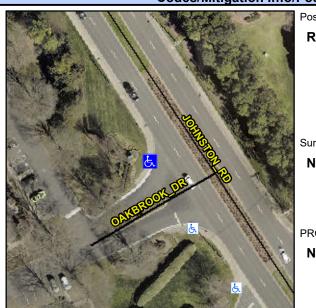

Street 1 Name OAKBROOK DR Stop Condition-Street 2 StopSign Street 2 Name N/A Stop Condition-Street 1 N/A

Possible Solutions:
Remove & Replace Entire Ramp.
Surveyor Notes:
N/A
N/A
PROW/ADA:
Not Found, R304.2.2, R304.5.3

Total Cost: 1850.00

Field Measurements/Component Compliance							
Compliance Description		Data	Comp	liance	Description	Data	
N/A	Ramp Length (in)	60.0	No	Ramp	Slope (%)	9.2	
Yes	Ramp Width (in)	48.0	No	• Ramp XSlope (%)		5.1	
N/A	Flare Type LT	N/A	N/A	/A Flare Type RT		N/A	
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)		N/A	
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?		N/A	
N/A	Landing Length (in)	N/A	N/A	DWS Provided?		N/A	
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?		N/A	
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A	
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A	
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A	
N/A	Shared Landing?	N/A					
N/A	Gutter Ponding?	N/A	N/A	Gutte	r Slope (%)	N/A	
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	r X Slope (%)	N/A	
N/A	Painted X Walk1?	No	N/A	Painte	ed X Walk2?	N/A	
	X Walk 1 Direction	To SE		X Wa	lk 2 Direction	N/A	
N/A	X Walk 1 Width (in)	N/A	N/A	X Wa	lk 2 Width (in)	N/A	
	X Walk 1 Slope (%)	1.9		X Wa	lk 2 Slope (%)	N/A	
	X Walk 1 X Slope (%)	4.1		X Wa	lk 2 X Slope (%)	N/A	
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp	inside XWalk2?	N/A	
	Road Slope (%)	N/A	N/A	Clear	Space?	N/A	
	Road X Slope (%)	N/A	N/A	Clear	Space to XWalk (in)	N/A	
N/A	Any Obstructions?	N/A	N/A	Storm	Grate/Utility Hazard?	N/A	
	Obstruction Type			Storm	Grate/Utility Type		
		N/A				N/A	
			Yes	Surfa	ce Condition? (G/P)	Good	
V Was to							





