


Intersection ID: 14704	Main Street: BELGRAVE_PL	Cross Street: ROMANY_RD	Location:	SW
ADA ID: 80D8A1A559B5	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

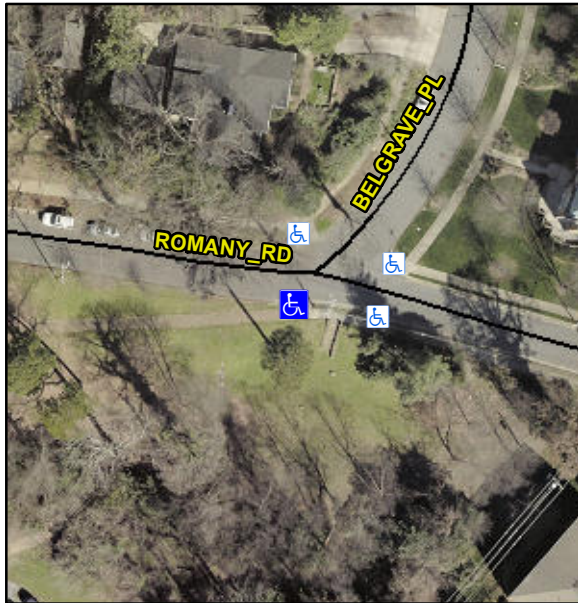

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

CURB GAP 1.5

PROW/ADA:

Not Found

Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
Remove & Replace Entire Ramp.	N/A	Ramp Length LT (in)	72.0	N/A	Ramp Length RT (in)	72.0		
	Yes	Ramp Width LT (in)	88.0	Yes	Ramp Width RT (in)	92.0		
	Yes	Ramp Slope LT (%)	7.5	Yes	Ramp Slope RT (%)	7.6		
	Yes	Ramp XSlope LT (%)	0.5	Yes	Ramp XSlope RT (%)	0.4		
	Yes	Landing Length (in)	88.0	Yes	DWS Provided?	Yes		
	Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes		
	Yes	Landing Slope (%)	0.5	Yes	DWS Length (in)	24.0		
	Yes	Landing X Slope (%)	0.1	Yes	DWS Full Width?	Yes		
	N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5		
	N/A	Shared Landing?	No					
Surveyor Notes:	Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.7		
	Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.9		
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A		
		X Walk 1 Direction	To N		X Walk 2 Direction	N/A		
	N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
		X Walk 1 Slope (%)	5.5		X Walk 2 Slope (%)	N/A		
		X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	N/A		
	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
		Road Slope (%)	N/A	N/A	Clear Space?	Yes		
		Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A		
CURB GAP 1.5	Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No		
		Obstruction Type			Storm Grate/Utility Type			
PROW/ADA:								
Not Found								
Total Cost:		\$	1600.00					
				N/A				N/A
				Yes	Surface Condition? (G/P)	Good		
				Replace	Curb Slope (%)	14.2		

Street 1 Name	ROMANY RD
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

