


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13108	Main Street: E MARTIN LUTHER KING JR BV	Cross Street: S DAVIDSON ST	Location: S
ADA ID: 80EFCF056A29	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 10.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

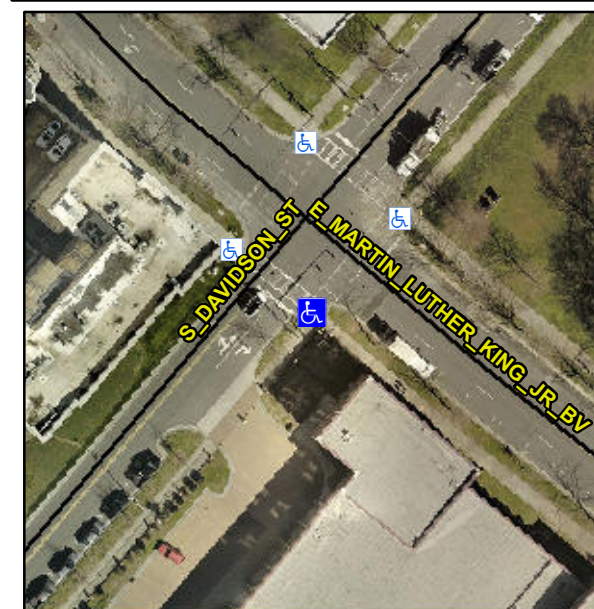

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Restripe Crosswalk(s) To Provide Clear space.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para

Total Cost: \$ 3700.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	89.0	Yes	Ramp Slope (%)	7.2
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.1
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	5.6	Yes	Flare Slope RT (%)	3.4
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	Yes			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.6
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	112.0	N/A	X Walk 2 Width (in)	90.0
	X Walk 1 Slope (%)	1.5		X Walk 2 Slope (%)	0.8
	X Walk 1 X Slope (%)	0.8		X Walk 2 X Slope (%)	2.2
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	1.3	N/A	Clear Space?	Yes
	Road X Slope (%)	0.8	No	Clear Space to XWalk (in)	20.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

