


# Access Compliance Report

## Public Rights-of-Way (Curb Ramps)

Intersection ID: 21109	Main Street: OAKHAVEN_DR	Cross Street: SANDY_PORTER_RD	Location: SW
ADA ID: 80FB7FBA9527	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.5	

### Codes/Mitigation Info/Possible Solution

### Field Measurements/Component Compliance

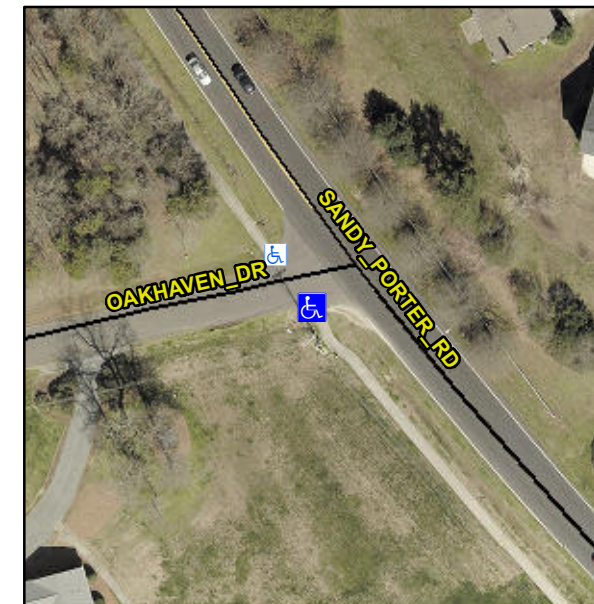

Possible Solutions:

**Remove & Replace Detectable  
Warning System.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R305.1.4**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	63.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	73.0	Yes	Grade Break Slope (%)	0.1
Yes	Ramp Slope (%)	0.2	Yes	Grade Break XSlope (%)	1.6
Yes	Ramp XSlope (%)	0.3			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	62.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	71.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.1	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.9	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	2.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	35.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.8
N/A	Painted X Walk1?	No		Road Slope (%)	1.4
	X Walk 1 Direction	To NW		Road X Slope (%)	0.3
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	1.4	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.3	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	5.0

Total Cost: \$ 800.00

Street 1 Name OAKHAVEN DR  
Stop Condition-Street 1 StopSign  
Street 2 Name N/A  
Stop Condition-Street 2 N/A

