


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 2549	Main Street: BEARDSLEY_DR	Cross Street: MCCHESENEY_DR	Location: E
ADA ID: 81185E6DBAF1	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 7.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

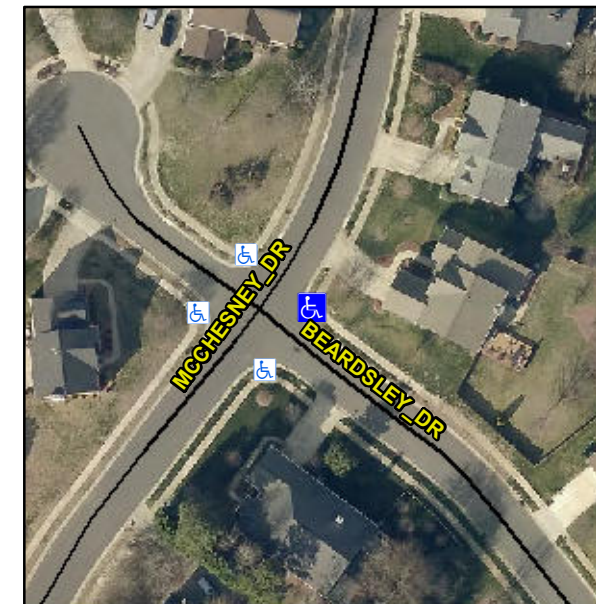

Possible Solutions:

Remove & Replace Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R305.2, R302.7.2, R304.5.3

Total Cost: \$ 1550.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	47.0	Yes	BlendTrans Slope (%)	4.0
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	1.3
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	4.0	N/A	Flare Slope RT (%)	10.1
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.6	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	2.0	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.2
No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	2.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	2.4
	X Walk 1 X Slope (%)	3.3		X Walk 2 X Slope (%)	1.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.5		Clear Space?	Yes
	Road X Slope (%)	5.5	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	0.2

Street 1 Name **MCCHESENEY DR**
 Stop Condition-Street 1 **None**
 Street 2 Name **BEARDSLEY DR**
 Stop Condition-Street 2 **StopSign**

