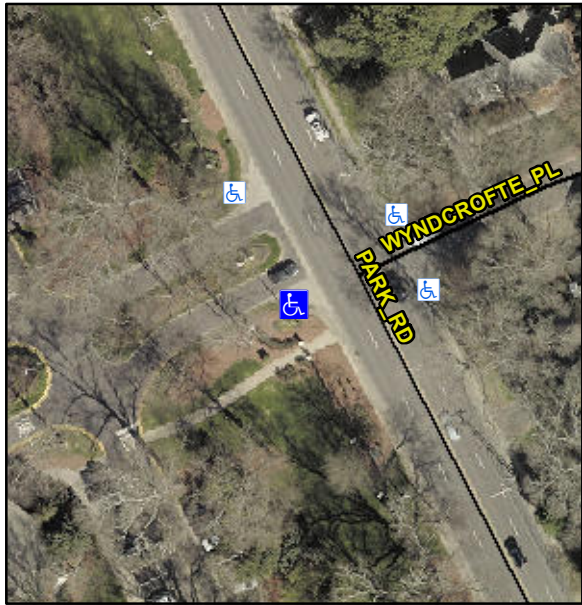


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 17141	Main Street: PARK_RD	Cross Street: WYNDCROFTE_PL	Location: SW
ADA ID: 811CDB611CCC	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	6.8
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.2
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	8.3	N/A	Flare Slope RT (%)	6.6
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
			No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
			No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
			No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
			No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
		N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	6.0	
		N/A	Shared Landing?	N/A				
		Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.2	
		Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.1	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To E		X Walk 2 Direction	To NE	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	2.7		X Walk 2 Slope (%)	4.3	
			X Walk 1 X Slope (%)	2.2		X Walk 2 X Slope (%)	3.5	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	1.4	N/A	Clear Space?	Yes	
			Road X Slope (%)	4.7	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
				N/A			N/A	
					Yes	Surface Condition? (G/P)	Good	

