


Intersection ID: 15684	Main Street: NORTON_RD	Cross Street: S_KINGS_DR	Location:	SE
ADA ID: 814D23D3AD78	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.					
	Surveyor Notes:		N/A					
	PROW/ADA:		Not Found, R304.2.2, R304.5.3					
	Total Cost:		\$ 3200.00					
Street 1 Name	NORTON RD		Compliance	Description	Data	Compliance	Description	Data
Stop Condition-Street 2	StopSign		N/A	Ramp Length (in)	87.0	No	Ramp Slope (%)	8.8
Street 2 Name	S KINGS DR		Yes	Ramp Width (in)	60.0	No	Ramp XSlope (%)	3.5
Stop Condition-Street 1	None		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To N		X Walk 2 Direction	To W
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	4.5		X Walk 2 Slope (%)	3.1
				X Walk 1 X Slope (%)	3.6		X Walk 2 X Slope (%)	2.6
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	0.5	N/A	Clear Space?	N/A
				Road X Slope (%)	4.3	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good

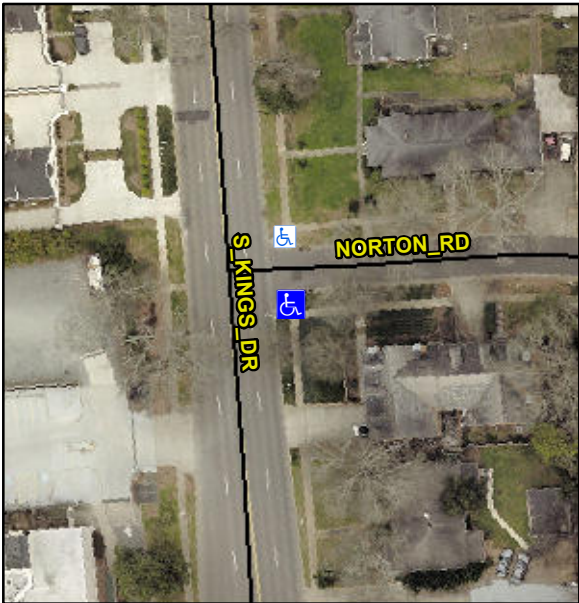